

# SE655 (WA9018) & SE965 (WA9016) End-Cap INSTALLATION INSTRUCTIONS



**WARNING!** Installation of any components must be performed using appropriate anti-static devices. If unavailable, discharge body static by touching a grounded metallic object before opening any covers on the hand-held.

Along with the end-cap (either SE655 or SE965), these kits include the following:

- M2.6x8L Torx T6 screws (x4)



**WARNING!** Always disconnect the unit from all power sources (battery & A/C power) before servicing components.

1. Remove the existing end-cap (x4 screws), back cover (x6 screws), and battery.
2. Slide the flex cable attached to the end-cap through the opening at the top of the unit, and secure the end-cap in place using the 4 screws included to a torque of 2.6 in-lbs.



3. Insert the flex cable into the 1D scanner connector, pushing the latch down to secure the flex cable in place.



4. Install the back cover (x6 screws) torqued to 2.6 in-lbs.
5. Insert the battery, and replace the battery cover.

## Once the end-cap is installed:

1. Press and hold down the **[Power]** **[FN/BLUE]** and the top-middle **[SCANNER]** button simultaneously to display the *Boot* menu.
2. Press the **[s]** key to display the *Scanner* menu. (For numeric keyboard users, press the **[FN/ORANGE]** key, press the **[7]** key four times, and then press the **[FN/ORANGE]** key again.)
3. Type the number corresponding with the end-cap you have installed – **67** to configure the *SE655*, or **63** to configure the *SE965*. Press **[ENTER]**.
4. Choose option **1** to run the main OS.

5. Press and hold down the **[Power] [FN/BLUE]** and the top-middle **[SCANNER]** button simultaneously to display the *Boot* menu again.



**NOTE** It is critical that you execute the previous step to display the *Boot* menu again; if this step is omitted, the DataWedge Status Icon indicates that DataWedge is in idle mode  making the capture device unavailable.

6. Next, perform a clean boot – at the *Command>* prompt, type **.clean** (for numeric keyboard users, type **.25326**). Press **[ENTER]**.



**NOTE** For Windows Embedded Hand-Held 6.5, clean booting the device removes the add-on CAB file. It must be re-installed.

#### To re-install the add-on CAB file:

1. Download the add-on CAB file from Ingenuity Working to your Workabout Pro4.
2. Double-click the add-on CAB filename to install the CAB file.

## Service Information

If you have a problem using the equipment, contact your facility's Technical or Systems Support. If there is a problem with the equipment, they will contact the Global Support Center at: <http://www.zebra.com/support>.



Zebra Technologies Corporation  
Lincolnshire, IL U.S.A.  
<http://www.zebra.com>

Zebra and the Zebra head graphic are registered trademarks of ZIH Corp. The Symbol logo is a registered trademark of Symbol Technologies, Inc., a Zebra Technologies Company.

© 2015 Symbol Technologies, Inc.

