



MC45 OPERATING SYSTEM BSP

01.09.0414 - HOTFIX CFE 1.0 RELEASE

NOTES

INTRODUCTION

This patch resolves following issue: On MC45, for 'Backlight & Keylight' applet, Key light 'Disabled' setting is not reboot persistent for 'Battery Power' and 'External Power' tabs.

DESCRIPTION

1. As part of the Fix, one more radio button named 'Persistent Disabled' is being added into 'Keylight' settings. In this option 'Disabled' settings are reboot persistent.
2. In the 'Persistent Disabled' option, following registry is being controlled, [HKEY_LOCAL_MACHINE\Drivers\BuiltIn\KeyLightDrv] "InitialState"=dword: 00000004 By default, "InitialState" value is set to 0. For Keylight 'Persistent Disabled' option, "InitialState" value will be set to 4.
3. If device is being clean booted by user or application, this FIX has to be re-installed.

CONTENTS

FIX_SPR23568_MC45_KeylightSettingsIssue_NoReboot.cab

FIX_SPR23568_MC45_KeylightSettingsIssue_WithReboot.cab

DEVICE COMPATIBILITY

This software release has been approved for use with the following Symbol devices .

Device	Operating System
MC45	Windows Mobile 6.5

INSTALLATION REQUIREMENTS

MC45 flashed with OEM Version 01.09.0414 and above



INSTALLATION INSTRUCTIONS

For NORMAL installation of the PATCH:

1. Copy "FIX_SPR23568_MC45_KeylightSettingsIssue_WithReboot.cab" file to the device by using ActiveSync.
2. Deploy the solution by tapping on the .cab file.
3. After successful deployment of the.cab file, device will do an automatic reboot.

For MSP or REMOTE installation of the PATCH:

1. Copy "FIX_SPR23568_MC45_KeylightSettingsIssue_NoReboot.cab" file to the device by using ActiveSync.
2. Deploy the solution by tapping on the .cab file.
3. Changes will take effect after a manual reboot of the terminal is done.

PART NUMBER AND RELEASE DATE

FIX_SPR23568_MC45_KeylightSettingsIssue_NoReboot.cab

FIX_SPR23568_MC45_KeylightSettingsIssue_WithReboot.cab

February 22, 2013