




# VC80 UPS Battery Pack and Thermal Pad Installation Instructions

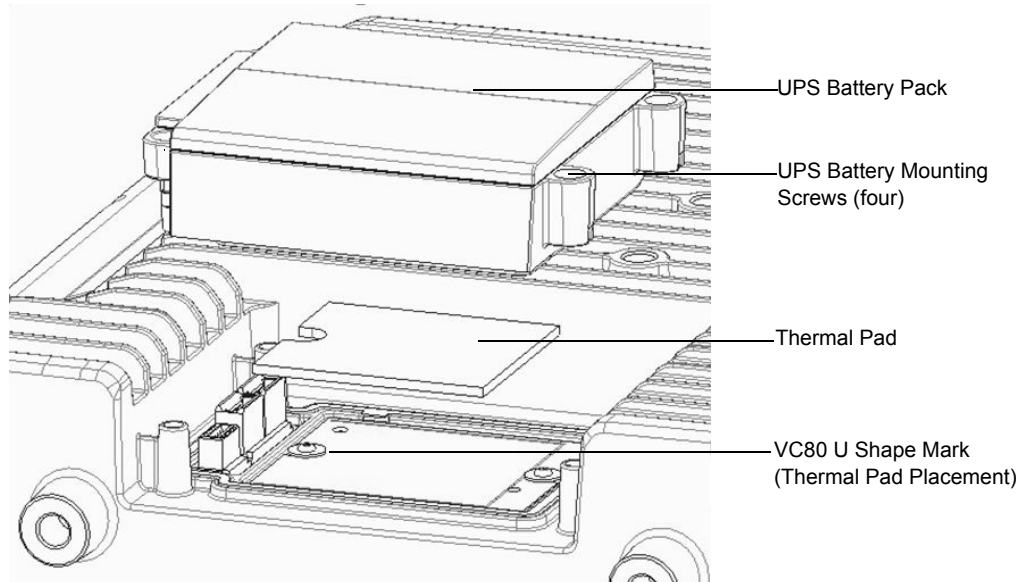

✓ **NOTE** Use only a Torx T10 screw driver.

To install the VC80 UPS battery pack and thermal pad:

1. Unscrew the four UPS battery mounting screws from the old UPS battery pack.
2. Remove the old UPS battery pack and thermal pad from the VC80.
3. Remove protective film from both sides of the new thermal pad.
4. Place the new thermal pad on the U shape mark area of the VC80.
5. Plug in the new UPS battery pack and press down firmly.
6. Screw the four UPS battery mounting screws on the new UPS battery in the following sequence:
  - a. Top left
  - b. Bottom right
  - c. Top right
  - d. Bottom left.
7. Torque the screws to 5.2 lb-in (6kgf-cm).

