

PAABCS00-013-R00

TAABCS00-005-R00

Contents

- [Description](#)
- [Device Compatibility](#)
- [Release Notes](#)
- [Components](#)
- [Installation](#)
- [Notes](#)
- [Late Additions](#)

Description

Thank you for selecting Zebra as your mobility solution tool provider.

For the latest software updates, go to the [Support Central](#) web site and select Software Downloads.

Thank you,

The Zebra Enterprise Mobility Software Development Team

[Back to Top](#)

Device Compatibility

This firmware is for CS3000/3070 devices.

[Back to Top](#)

Release Notes

PAABCS00-013-R00 (new) / TAABCS00-005-R00 (unchanged)

1. Updated firmware to support newest engine hardware.

IMPORTANT NOTE : Do not downgrade new units with firmware PAABCS00-013-R00 to older versions of firmware as this may cause erroneous behavior.

PAABCS00-012-R00 (unchanged) / TAABCS00-005-R00 (new)

2. Radio firmware updated to fix issue where with some host applications not all data was seen by the host when transmitted via Bluetooth Serial Port Profile (SPP).

PAABCS00-012-R00 (new) / TAABCS00-004-R00 (unchanged)

1. Low level software NAND flash driver was updated to support new flash part.

NOTE 1: The software is not forward compatible with new hardware. The model number on the scanner has not changed to distinguish between the old and the new hardware. In light of this fact, if a user tries to load or do a live update of old software (i.e. ≤ 011 , \leq PAABCS00-012-RXXB1) onto new hardware then when the user pulls the USB cable the scanner will sound 5 short hi-beep tones, and the LED will blink red 5 times. The new software (i.e. ≥ 012 , \geq PAABCS00-012-RXXB1) will delete this old software on the scanners flash drive and the scanner will boot into normal operation executing this new software. See the LED Indications and Beeper Indications tables in the latest revision of the PRG under “Failed software download” in the User Interface Definitions section.

NOTE2: The software is not completely backward compatible with new software (i.e. ≥ 012 , \geq PAABCS00-012-RXXB1) running on old hardware. If a user already loaded new software on old hardware and wishes to go back to old software (i.e. ≤ 011 , \leq PAABCS00-012-RXXB1) then please follow this procedure to manually start the old software.

- A) If after copying the binary file onto the CS3070 drive and unplugging USB, if the scanner fails to respond and appears locked up then do the following:

- a. Remove the back cover and locate the recessed reset button on the lower right backside of the scanner.
- b. Using a modified paper clip or needle type tool, press and release the reset button, to manually start the old software.
- c. After pressing and releasing the reset button, press and release the plus key at least twice. The scanner will wake-up and begin normal processing executing the old software.

NOTE: See the Troubleshooting table in the Maintenance and Troubleshooting chapter of the latest PRG under the Problem column that states “Scanner is unresponsive after performing a live update software download”. This same procedure is listed.

2. In this software if a user sets the CONFIG.INI file to Read ONLY, then if any parameter barcodes are scanned the scanner will issue an error beep (i.e. Low to High Long Beep)

PAABCS00-011-R00 (new) / TAABCS00-004-R00 (unchanged)

1. Fixes issue where in batch mode, if the first barcode scanned was deleted, the first line of BARCODES.txt has either a 1 or a 0 as the first entry in the file. Deleting any barcode other than the first one, the file is presented properly.

PAABCS00-010-R00 / TAABCS00-004-R00

1. Fixes issue with CS3070 not reconnecting to an iPhone and an iPad when they resume after sleep..
2. Fixes issue with pairing to MAC.

PAABCS00-009-R00

1. This release allows the user to synch the Real Time Clock with the time on their PC or notebook, using the RTC Synch utility.

PAABCS00-008-R00

1. Fixes issues with unit when prefix / suffix are enabled

PAABCS00-007-R00 / TAABCS00-003-R00

1. Added feature to allow IPAD virtual keyboard to be usable while the CS3070 is attached
2. Fixed HID transmission issue
3. Fixed barcode deletion issue.

[Back to Top](#)

Components

(If applicable)

Component	Location
PAABCS00-013-R00	
TAABCS00-005-R00	

[Back to Top](#)

Installation

[Back to Top](#)

Notes

[Back to Top](#)

Late Additions

[Back to Top](#)

Copyright (c) 2003-2019

Zebra Technologies, Inc