

---

# Release Notes - VC70 CE 7.0 - BSP v05.57.03 - HotFix CFE v02.09.00 Package

---

[Introduction](#)

[Description](#)

[Package Details](#)

[Device Compatibility](#)

[Installation Requirements](#)

[Installation Instructions](#)

[Release Date](#)

## Introduction

---

HotFix CFE (Cumulative Fixes from Engineering) Package contains multiple SPR Hotfixes into a single package. The HotFix CFE Package helps the end users to keep up to date with all the SPR Hotfixes for given product software release / revision.

HotFix CFE packages are validated only by engineering validation team and the package follows Zebra Technologies HotFix Package Policy. Click here to view [HotFix Package Policy](#).

## Description

---

CFE package

CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_WB.cab/CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_NB.cab file includes the following HotFixes:

SPR No	Synopsis
33042	Added support for Extended Function Keys (F13 to F24) in USB keyboard driver
32557	SIP would not open in the Soti LockDown Login screen
31819	Screen taps sound volume and external key board key press sound volume is low for the first time. It will return to normal volume after first screen taps or first key press. If the delay between key press or screen taps is more than 1sec, volume will be low for all the next key press or screen taps
31278	Stylus right click and double click in Remote Desktop doesn't work
30676	When opening a Multi-File Playlist in windows Media Player, first file is opened and played and when next file is attempted to be opened / played Windows Media Player closes/disappears
29193	Audio dropout when using Bluetooth Audio (WBA) headset
30681	DataWedge is not turning to ready state when DS3608 scanner connected to VC70 in SSI mode.

30742	Sometimes the audio is not routed BT Headset or audio is not recorded through microphone when HS3000 BT Headset connected/disconnected several times manually .
29685	RDP connection bar scatter when we scroll in RDP session.

This HotFix CFE package

CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_WB.cab/CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_NB.cab  
obsoletes the following HotFix CFEs:

HotFix CFE version
CFE_VC70_CE_055703_EN_v020800_e_WB.cab
CFE_VC70_CE_055703_EN_v020800_e_NB.cab

*Note: Latest CFE package includes previous CFE package hot fixes and new SPR hot fix.*

## Package Details

CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_WB.cab (CFE package with auto Warm boot)

CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_NB.cab (CFE package without auto Warm boot)

## Device Compatibility

This HotFix CFE Package software release has been approved for use with the following Zebra devices.

Device	Operating System	BSP Version
VC70	CE 7.0	v05.57.03

## Installation Requirements

The HotFix CFE cab can be deployed to the Mobile device through any one of the below mentioned methods. For installing the cab, the users should have at least one of the below mentioned tools.

- Windows Mobile Device Center (For Windows Desktops)
- SD Cards / Micro SD cards
- MDM set up

## Installation Instructions

### For Normal installation of the PATCH:

- **Windows Mobile Device Center (For Windows Desktops) Installation Instructions:**
  1. Copy "CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_WB.cab" file to the Application folder on the device.

2. Deploy the solution by tapping on the "CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_WB.cab" file.
  3. After successful deployment of the "CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_WB.cab" file, device will do an automatic warm boot.
- **SD Cards / Micro SD cards Installation Instructions:**
    1. Copy "CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_WB.cab " file to the SD card.
    2. Deploy the solution by tapping on the "CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_WB.cab"
    3. After successful deployment of the "CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_WB.cab" file, device will do an automatic warm boot.

### **For MSP or REMOTE installation of the PATCH:**

1. Set up MDM (MSP, Soti, Airwatch, etc..) to send "CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_NB.cab" file to the application folder of the device.
2. To deploy the solution, setup in MDM to install the cab file"CFE\_VC70\_CE\_055703\_EN\_v020900\_e\_NB.cab" file.
3. Changes will take effect after a manual reboot of the terminal or if MDM reboots device.

## **Release Date**

---

October, 2017