# Release Notes - WT41N0 CE7 Rev C1 - 03.54.10

**Introduction** 

**Description** 

**Contents** 

**Device Compatibility** 

**Installation Requirements** 

**Installation Instructions** 

Part Number and Release Date

## 1 Introduction

WT41N0 is the Next Generation version of earlier wearable series of mobile computer WT4090. WT41N0 arm's your workers with all new advanced real-time hands-free mobile computing. This rugged mobile computing device with 802.11 a/b/g/n will allow you to achieve maximum error-proof productivity, operational efficiency and accuracy through voice compatibility for streamlined warehouse and package handling functions. This release contains the SW required to update a WT41N0 CE7.0 device to the Rev C software.

# 2 Description

- 1. Operating System: CE7.0.
- 2. Microsoft QFE April 2014, Update 34, Build 2838
- 3. CPU OMAP4430 ES 2.3.
- 4. External Agent 02.54

### 3 **Enhancements**

### 4 SPRs fixed

SPR 26828 – Resolved an issue where the audio output was with broken noise.

### 5 **Notes**

- The Batteryhealth application is included as part of the OS image. This application can be installed by double clicking on Start->Program->BatteryHealth to install the cab file and cold boot the device.
- While streaming video files from Web for a long hours, it is recommended to change the default Temporary Internet Files registry path to the following.  $[HKEY\_CURRENT\_USER \setminus Software \setminus Microsoft \setminus Windows \setminus Current Version \setminus Exploit A variable of the property o$ rer\Shell Folders] "Cache"="\\Application\\Temporary Internet Files"
- RCM Trigger Notification Support has been added via the following registry. By default RCM trigger Notification is disabled. Please set below registries to enable

[HKEY LOCAL MACHINE\Drivers\BuiltIn\BarCodeReader\Settings] "TriggerEventEnable"=dword:1 [HKEY\_LOCAL\_MACHINE\Drivers\BuiltIn\BarCodeReader\Configurations\SE 965\Settings] "TriggerEventEnable"=dword:1 [HKEY\_LOCAL\_MACHINE\Drivers\BuiltIn\BarcodeReaderBT\Settings] "TriggerEventEnable"=dword:1

To enable IE KIOSK feature reset the below registry keys to 0, [HKEY CURRENT USER\Software\Microsoft\Internet Explorer\Main] "Task Bar"=dword:00000000

"Status"=dword:00000000

"Command Bar"=dword:00000000

"Animation"=dword:00000000

"Menu Bar"=dword:00000000

"URL"=dword:00000000

SPR 24711: RF Apps performance can be improved by setting the below registry key for the specific <**Nic Adapter Name**> like XWING, SMSC9500, RndisFn, AsyncMac, PPTP, L2TP, PPPOE, LANNDS

[HKEY\_LOCAL\_MACHINE\Comm\< Nic Adapter Name>\Parms\Tcpip] "TcpAckFrequency"=dword:1

### 6 Contents

- 1. 41X0BenUP035410.zip OS Update Package v03.54.10 without CleanAppl for Touch and Non-Touch terminals
- 2. 41X0BenUC035410.zip OS Update Package v03.54.10 with CleanAppl for Touch and Non-Touch terminals
- 3. 41X0c70BenAB035410.APF Airbeam Package v03.54.10 without CleanAppl for Touch, Non-Touch and VoW Terminals
- 4. 41X0c70BenAC035410.APF Airbeam Package v03.54.10 with CleanAppl for Touch, Non-Touch and VoW Terminals
- 5. 41X0BenVUP035410.zip OS Update Package v03.54.10 for VoW terminals without CleanAppl
- 6. 41X0BenVUC035410.zip OS Update Package v03.54.10 for VoW terminals with CleanAppl

# **7** Device Compatibility

This software release has been approved for use with the following Symbol devices.

Device	Operating System
WT41N0	Windows CE7.0

# **8** Installation Requirements

WT41N0 device must contain released version of CE7.0 Software.

# **9** Installation Instructions

- 1. Unzip ZIP file and copy its content ("OSUpdate" folder for Touch & Non Touch or "OSUpdate\_VOW" folder for VOW) to the \Temp folder of the terminal.
- 2. Place the device to be upgraded on A/C power supply.

3. Navigate to the "\Temp\OSUpdate" folder for Touch & Non Touch terminal or "\Temp\OSUpdate\_VOW" folder for VOW terminal. Invoke 41X0c70Ben\_TEMP shortcut.

Important note: The update will take about 1 minute to complete. Please do not remove the device from A/C power during this time.

# 10 Part Number and Release Date

- 41X0BenUC035410
- 41X0BenUP035410
- 41X0c70BenAB035410
- 41X0c70BenAC035410
- 41X0BenVUC035410
- 41X0BenVUP035410

July 06, 2015