

# Release Notes – Zebra Android 10

## 10-16-10.00-QG-U70-STD-HEL-04 Release (GMS)

### Highlights

This Android 10 GMS release 10-16-10.00-QG-U70-STD-HEL-04 covers TC72, TC77, TC52, TC57, TC21, TC26, TC52x, TC57x, MC3300x, MC3300xR, L10A, PS20, TC8300, MC93, VC83, EC30, EC50, EC55, CC600, CC6000, WT6300, MC2200, MC2700 family of products. Please see, Device Compatibility under Device Support Section for more details.

LifeGuard patches are cumulative and include all previous fixes that are part of earlier patch releases.

### Software Packages

| Package Name                                      | Description       |
|---|-------------------|
| HE_DELTA_UPDATE_10-16-10.00-QG-U70-STD-HEL-04.zip | LG Package Update |

### Security Updates

This build is Compliant up to [Android Security Bulletin](#) of April 05, 2021.

### LifeGuard Update 70

➤ This LG patch is applicable for 10-16-10.00-QG-U00-STD-HEL-04 BSP version.

- **New Features**

- None

- **Resolved Issues**

- None

- **Usage Notes**

- None

## LifeGuard Update 44

- This LG patch is applicable for 10-16-10.00-QG-U00-STD-HEL-04 BSP version.
  - This LG Patch includes following updated components.
    - Audio: 0.31.0.0
    - Bluetooth Pairing Utility: 3.20
    - DataWedge: 8.2.211
    - EMDK: 9.0.3.3003
    - License Manager and License Agent: 5.0.0 and version 5.0.0. 5.0.0
    - MXMF: 10.3.0.18
    - OSX: QCT.100.10.5.58
    - Scanning Framework: 28.9.8.0
    - StageNow: 5.1.0.1
  - **New Features**
    - Added support for Keyboard Audible Feedback feature on MC3300x, MC3300xR, MC9300, MC2200, MC2700 and VC8300 and ability to control volume of Keyboard Audible Feedback by MDM.
    - Added support to enable/disable DHCPv6 feature using DHCPOptionMgr CSP. Stateful DHCPv6 helps Admins track and block network abuses. With stateful DHCPv6 a client is likely to keep a stable IP as long as it stays on the same network.
    - Added support to see SAM Bridge FW Version in SW Component.
    - Added support to enable Low level NFC NCI Logging to get detailed logs for NFC scenarios for debugging purpose, logs are included as part of RxLogger logs.
    - Added support in OemInfo to allow customer applications and sideloaded applications to read BT MAC address.
    - Provided additional option for the user to change the touch panel mode configuration from Power Menu without going into settings menu once it is enabled using the CSP file.
    - Added support for Multibarcode - Automatic group identification.
    - Added support for Multibarcode - Read only specific barcodes.
    - Added support to remove Bluetooth pairing list.
    - Added support to pair BT Scanner at Google Setup Wizard (Welcome screen) to efficiently stage the device for devices without inbuilt scanner.
  - **Resolved Issues**
    - SPR-40819 : Resolved an issue wherein 7-bit ASCII encoded data matrix code was not getting decoded.
    - SPR-41039 : Updated the APN details for Bulgarian operator A1.
    - SPR-40216 : Resolved an issue wherein flash LED temperature was very high when torch was turned ON for a longer duration.
    - SPR-38667 : Resolved an issue wherein user was unable to remotely browse files over VPN.
    - SPR-40400 : Resolved an issue wherein device was losing WWAN connectivity at higher temperatures.

- SPR-41255 : Resolved an issue wherein devices were getting stuck in recovery screen during MDM enrollment.
- SPR-41056 : Resolved an issue wherein SIM not detected toast message used to appear even with a valid SIM.
- SPR-39513 : Resolved an issue wherein intermittently display would not turn on upon wakeup from suspend.
- SPR-39544 : Resolved an issue where eMMC health was not being retrieved correctly on certain flash part.
- SPR-41094 : Resolved an issue wherein during a call, user gets echo while the other user was on speaker mode.
- SPR-41144 : Resolved an issue wherein the EMM Enrollment was not working over ethernet connection.
- SPR-41622 : Resolved an issue wherein additional touch events were occurring for a single touch press.
- SPR-38739 : Resolved an issue wherein streaming of certain MP3 files used to fail.
- SPR-41400 : Resolved an issue wherein key remapping was not working for CTRL and other advanced key modifiers using OemConfig.
- SPR-41578 : Added support for enabling/disabling “key press sounds” via StageNow.
- SPR-41397 : Resolved an issue wherein intermittently WLAN failed to turn On.
- SPR-39082 : Resolved an issue wherein Intermittent loss of Ethernet connection is observed.
- SPR-41260 : Resolved an issue wherein third-party VPN Apps were unable to access certificates (installed via StageNow/MX) on the device resulting in not able to connect to the server.
- SPR-41915 : Enabled Serial Port Comm API support.
- Fixed an issue wherein device crash was seen when STC SIM was inserted.

- **Usage Notes**

- None

## **LifeGuard Update 28**

- This LG patch is applicable for 10-16-10.00-QG-U00-STD-HEL-04 BSP version.

- **New Features**

- None

- **Resolved Issues**

- None

- Usage Notes

- None

### LifeGuard Update 26

➤ This LG patch is applicable for 10-16-10.00-QG-U00-STD-HEL-04 BSP version.

- New Features

- None

- Resolved Issues

- None

- Usage Notes

- None

### LifeGuard Update 16

➤ This LG patch is applicable for 10-16-10.00-QG-U00-STD-HEL-04 BSP version.

- New Features

- None

- Resolved Issues

- None

- Usage Notes

- None

### Version Information

Below Table contains important information on versions

| Description          | Version                       |
|----------------------|-------------------------------|
| Product Build Number | 10-16-10.00-QG-U70-STD-HEL-04 |
| Android Version      | 10                            |

|                      |  |
|----------------------|--|
| Security Patch level | April 5, 2021  |
| Component Versions   | Please see Component Versions under Addendum section |

## Known Constraints

- Picture quality of the image taken with 'Night Mode' in low-light conditions is poor.
- Trigger Modes: Presentation Read Mode is preferred over Continuous Read Mode. If using Continuous Read mode, use a lower illumination brightness setting (e.g., 2) to ensure the scanner can work without interruption.
- "Red Eye Reduction" feature disables the camera flash in the device. Hence, to enable the camera flash please disable the 'Red Eye Reduction' feature.
- EMM does not support agent persistence in OS dessert downgrade scenario.
- Reset packages of Oreo and Pie should not be used on devices running with A10 software.
- In-order to avoid any inconsistencies in Settings UI it is recommended to wait for a few seconds after the device boots up.
- Transparent blue overlay in camera view –numeric, character or ENTER key presses in camera view will make this blue overlay appear. The camera is still functional; however, the view is covered with the blue overlay. To clear this, press the TAB key to move the control to a different menu item or close the camera app.
- In case of an OS upgrade from a s/w version having higher security patch level to a s/w version having lower security patch level, user data will be reset.
- TC5x flash LED temperature is too high when torch is on for long time.
- Unable to scan remote company network using ES file explorer over VPN.
- In case USB flash drives are not getting detected on VC8300 after reboot on USB-A port, re-insert the USB flash drive after the device is fully powered up & on home screen.
- On WT6300 with RS4000 & RS5000 usage, the DataWedge option "Keep enabled on suspend" (in Profiles > Configure scanner settings) shall NOT be set, user can set "Trigger Wakeup and Scan"(in Profiles > Configure scanner settings > Reader params) for single trigger wake and scan functionality.
- When phone app is being disabled using MDM and user tries to reboot the device, user might see **Recovery Screen** with "Try again" and "Factory data reset" options. Select option "Try again" to continue the reboot process. Do not select option "Factory data reset", as it will erase the user data.
- AppManager actions only apply to the applications on the device at the time "DisableGMSApps" is called. New GMS applications present in any new OS update will not be disabled following that update
- After upgrading from Oreo to A10, Device shows "SD card setup" notification, which is expected behavior from AOSP.
- After upgrading from Oreo to A10, staging fails on few packages, user must update package names accordingly and make use of the profiles or create new staging profiles.
- At the very first time, DHCPv6 enable through CSP is not reflecting until user disconnect/reconnect to the WLAN profile.

## Important Links

- [Installation and setup instructions](#) (if the link does not work please copy It to browser and try)

**Note:**

“As part of IT security best practices, Google Android enforces that the Security Patch Level (SPL) for the new OS or patch must be the same level or a newer level than the OS or patch version currently on the device. If the SPL for the new OS or patch is older than the SPL currently on the device, then the device will enterprise reset and wipe all user data and settings including user network configurations and remote management tools which would render the device inaccessible over a network.”

- [Zebra Techdocs](#)
- [Developer Portal](#)

## Device Support

### Device Compatibility

This software release has been approved for use on the following devices.

| Device Family | Part Number  |  | Device Specific Manuals and Guides |
|---------------|--|--|------------------------------------|
| TC21          | TC210K-01A222-A6<br>TC210K-01A242-A6<br>TC210K-01D221-A6<br>TC210K-01D241-A6<br>TC210K-01B212-A6<br>TC210K-01B232-A6<br>TC210K-01A422-A6<br>TC210K-01A442-A6<br>TC210K-0HD224-A6<br>TC210K-0HB224-A6<br>TC210K-0HB222-A6<br>TC210K-01A423-A6<br>TC210K-0KB224-A6<br>TC210K-01B422-NA<br>TC210K-01A222-NA<br>TC210K-01D221-NA<br>TC210K-01D241-NA<br>TC210K-01B212-TR<br>TC210K-01B212-RU<br>TC210K-0JD224-NA<br>TC210K-0JB224-NA<br>TC210K-01D221-TR<br>TC210K-01D241-TR | TC210K-01A242-NA<br>TC210K-01A442-NA<br>TC210K-01B212-NA<br>TC210K-01B232-NA<br>TC210K-01A423-NA<br>TC210K-0HD224-NA<br>TC210K-0HB224-NA<br>TC210K-0HB222-NA<br>TC210K-0KD224-NA<br>TC210K-0HD224-FT<br>TC210K-01A222-IA<br>TC210K-01A242-IA<br>TC210K-01A442-IA<br>TC210K-01B212-IA<br>TC210K-01B232-IA<br>TC210K-0HB224-IA<br>TC210K-01B212-XP<br>TC210K-01B232-TR<br>TC210K-01A422-IA<br>TC210K-01A222-RU<br>TC210K-01B232-RU<br>TC210K-0JB224-A6 | <a href="#">TC21 Home Page</a>     |
| TC26          | TC26AK-11A222-NA<br>TC26AK-11A242-NA<br>TC26AK-11A422-NA<br>TC26AK-11A423-NA<br>TC26AK-11B212-NA<br>TC26AK-11B232-NA   | TC26BK-11A442-IA<br>TC26BK-11B212-A6<br>TC26BK-11B212-BR<br>TC26BK-11B212-IA<br>TC26BK-11B212-ID<br>TC26BK-11B212-RU   | <a href="#">TC26 Home Page</a>     |

|         |  |  |                                   |
|---------|--|--|-----------------------------------|
|         | TC26AK-11D221-NA<br>TC26AK-11D241-NA<br>TC26AK-1HB222-NA<br>TC26AK-1HB224-NA<br>TC26AK-1HD224-FT<br>TC26AK-1HD224-NA<br>TC26AK-1JD224-NA<br>TC26AK-21A222-NA<br>TC26BK-11A222-A6<br>TC26BK-11A222-BR<br>TC26BK-11A222-IA<br>TC26BK-11A242-A6<br>TC26BK-11A242-BR<br>TC26BK-11A242-IA<br>TC26BK-11A422-A6<br>TC26BK-11A422-BR<br>TC26BK-11A423-A6<br>TC26BK-11A423-BR<br>TC26BK-11A442-A6<br>TC26BK-11A442-BR<br>TC26BK-11A222-ID<br>TC26BK-11A222-RU<br>TC26BK-11B232-RU<br>TC26DK-1HB224-TR<br>TC26AK-1JB224-NA | TC26BK-11B212-XP<br>TC26BK-11B232-A6<br>TC26BK-11B232-BR<br>TC26BK-11B232-IA<br>TC26BK-11B412-A6<br>TC26BK-11D221-A6<br>TC26BK-11D221-BR<br>TC26BK-11D241-A6<br>TC26BK-11D241-BR<br>TC26BK-1HB224-A6<br>TC26BK-1HB224-BR<br>TC26BK-1HB224-IA<br>TC26BK-1HD224-A6<br>TC26BK-1JB224-A6<br>TC26BK-21A222-A6<br>TC26BK-21A222-IA<br>TC26BK-21D221-A6<br>TC26DK-11B212-TR<br>TC26DK-11B232-TR<br>TC26BK-11D421-A6<br>TC26BK-11B212-TR<br>TC26BK-11B232-TR<br>TC26DK-11D221-TR<br>TC26DK-11D241-TR |                                   |
| PS20    | PS20J-P4G1A600<br>PS20J-P4G1A600-10<br>PS20J-B2G1A600<br>PS20J-B2G1A600-10<br>PS20J-P4H1A600<br>PS20J-P4H1A600-10<br>PS20J-B2G2CN00<br>PS20J-P4H2CN00  | PS20J-P4G2CN00<br>PS20J-P4G1NA00<br>PS20J-P4G1NA00-10<br>PS20J-B2G1NA00<br>PS20J-B2G1NA00-10<br>PS20J-P4H1NA00<br>PS20J-P4H1NA00-10<br>PS20J-P4G1RU00  | <a href="#">PS20 Home Page</a>    |
| MC3300x | MC330L-RL2EG4NA<br>MC330L-RL3EG4NA<br>MC330L-RL4EG4NA<br>MC330L-RL2EG4RW<br>MC330L-RL3EG4RW<br>MC330L-RL4EG4RW<br>MC330L-RC2EG4NA<br>MC330L-RC3EG4NA<br>MC330L-RC4EG4NA<br>MC330L-RC2EG4RW<br>MC330L-RC3EG4RW<br>MC330L-RC4EG4RW<br>MC330L-SL2EG4NA<br>MC330L-SL3EG4NA<br>MC330L-SL4EG4NA<br>MC330L-SL2EG4RW<br>MC330L-SL3EG4RW<br>MC330L-SL4EG4RW<br>MC330L-SC2EG4NA  | MC330L-GE3EG4NA<br>MC330L-GE4EG4NA<br>MC330L-GE2EG4RW<br>MC330L-GE3EG4RW<br>MC330L-SC2EG4RW<br>MC330L-SC3EG4RW<br>MC330L-SC4EG4RW<br>MC330L-SJ2EG4NA<br>MC330L-SJ3EG4NA<br>MC330L-SJ4EG4NA<br>MC330L-SJ2EG4RW<br>MC330L-SJ3EG4RW<br>MC330L-SJ4EG4RW<br>MC330L-SA2EG4NA<br>MC330L-SA3EG4NA<br>MC330L-SA4EG4NA<br>MC330L-SA2EG4RW<br>MC330L-SA3EG4RW<br>MC330L-SA4EG4RW  | <a href="#">MC3300x Home Page</a> |

|          |   |  |   |
|----------|---|--|---|
|          | <p>MC330L-SC3EG4NA<br/> MC330L-SC4EG4NA<br/> MC330L-SK2EG4NA<br/> MC330L-SK3EG4NA<br/> MC330L-SK4EG4NA<br/> MC330L-SK2EG4RW<br/> MC330L-SK3EG4RW<br/> MC330L-SK4EG4RW<br/> MC330L-SM2EG4NA<br/> MC330L-SM3EG4NA<br/> MC330L-SM4EG4NA<br/> MC330L-SM2EG4RW<br/> MC330L-SM3EG4RW<br/> MC330L-SM4EG4RW<br/> MC330L-SE2EG4NA<br/> MC330L-SE3EG4NA<br/> MC330L-SE4EG4NA<br/> MC330L-SE2EG4RW<br/> MC330L-SE3EG4RW<br/> MC330L-SE4EG4RW<br/> MC330L-SG2EG4NA<br/> MC330L-SG3EG4NA<br/> MC330L-GE2EG4NA<br/> MC330L-GE4EG4RW<br/> MC330L-GE3EG4IN<br/> MC330L-GE4EG4IN<br/> MC330L-SG3EG4IN<br/> MC330L-SA3EG4TR<br/> MC330L-SG3EG4TR<br/> MC330L-SJ2EG4RU<br/> MC330L-SA2EG4RU<br/> MC330L-SG3EG4RU<br/> MC330L-SE3EG4RU<br/> MC330L-GJ2EG4RU<br/> MC330L-GE3EG4RU<br/> MC330L-GE2EG4RU</p> | <p>MC330L-SA4EG4IN<br/> MC330L-SG4EG4NA<br/> MC330L-SG2EG4RW<br/> MC330L-SG3EG4RW<br/> MC330L-SG4EG4RW<br/> MC330L-GL2EG4NA<br/> MC330L-GL3EG4NA<br/> MC330L-GL4EG4NA<br/> MC330L-GL2EG4RW<br/> MC330L-GL3EG4RW<br/> MC330L-GL4EG4RW<br/> MC330L-GL3EG4IN<br/> MC330L-GL4EG4IN<br/> MC330L-GJ2EG4NA<br/> MC330L-GJ3EG4NA<br/> MC330L-GJ4EG4NA<br/> MC330L-GJ2EG4RW<br/> MC330L-GJ3EG4RW<br/> MC330L-GJ4EG4RW<br/> MC330L-SJ3EG4IN<br/> MC330L-SJ4EG4IN<br/> MC330L-GJ3EG4IN<br/> MC330L-GJ4EG4IN<br/> MC330L-GJ3EG4RW01<br/> MC330L-GJ3EG4NA01<br/> MC330L-GJ3EG4IN01<br/> MC330L-SA3EG4IN<br/> MC330L-SA4EG4TR<br/> MC330L-SG4EG4TR<br/> MC330L-SJ3EG4RU<br/> MC330L-SA3EG4RU<br/> MC330L-SK3EG4RU<br/> MC330L-GJ3EG4RU<br/> MC330L-GJ4EG4RU<br/> MC330L-GE4EG4RU</p> |   |
| MC3300xR | <p>MC333U-GJ2EG4EU<br/> MC333U-GJ2EG4IL<br/> MC333U-GJ2EG4US<br/> MC333U-GJ3EG4EU<br/> MC333U-GJ3EG4US<br/> MC333U-GJ4EG4EU<br/> MC333U-GJ4EG4IN<br/> MC333U-GJ4EG4JP<br/> MC333U-GJ4EG4US<br/> MC333U-GJ4EG4WR<br/> MC339U-GE2EG4EU<br/> MC339U-GE2EG4US<br/> MC339U-GE3EG4EU<br/> MC339U-GE3EG4US<br/> MC339U-GE4EG4EU<br/> MC333U-GJ4EG4SL</p>   | <p>MC339U-GE4EG4IN<br/> MC339U-GE4EG4JP<br/> MC339U-GE4EG4US<br/> MC339U-GE4EG4WR<br/> MC339U-GF2EG4EU<br/> MC339U-GF2EG4US<br/> MC339U-GF3EG4EU<br/> MC339U-GF3EG4US<br/> MC339U-GF4EG4EU<br/> MC339U-GF4EG4US<br/> MC339U-GF4EG4WR<br/> MC339U-GF4EG4TH<br/> MC339U-GE4EG4TH<br/> MC333U-GJ4EG4TH<br/> MC339U-GF4EG4SL</p>   | <p><a href="#">MC3300xR Home Page</a></p> |



|                            |  |   |                                   |
|----------------------------|--|---|-----------------------------------|
| TC52                       | TC520K-1PEZU4P-A6<br>TC520K-1PEZU4P-NA   | TC520K-1PEZU4P-IA<br>TC520K-1PEZU4P-FT  | <a href="#">TC52 Home Page</a>    |
| TC52 –<br>AR1337<br>Camera | TC520K-1PFZU4P-A6  | TC520K-1PFZU4P-NA   | <a href="#">TC52 Home Page</a>    |
| TC52 HC                    | TC520K-1HEZU4P-NA<br>TC520K-1HEZU4P-A6   | TC520K-1HEZU4P-FT<br>TC520K-1HEZU4P-IA  | <a href="#">TC52 HC Home Page</a> |
| TC52X                      | TC520K-1XFMU6P-NA<br>TC520K-1XFMU6P-A6<br>TC520K-1XFMU6P-TK  | TC520K-1XFMU6P-FT<br>TC520K-1XFMU6P-IA  | <a href="#">TC52X Home Page</a>   |
| TC57X                      | TC57HO-1XFMU6P-A6<br>TC57HO-1XFMU6P-BR<br>TC57HO-1XFMU6P-IA  | TC57HO-1XFMU6P-ID<br>TC57JO-1XFMU6P-TK<br>TC57HO-1XFMU6P-NA   | <a href="#">TC57X Home Page</a>   |
| L10A                       | RTL10B1-xxxxxxxxNA<br>(North America)<br>RTL10B1-xxAxxX0x00A6<br>(ROW)<br><i>Note: 'x' Stands for wild card for<br/>different configurations</i>   | RTL10B1-xxAxxX0x00IN<br>(India)<br>RTL10B1-xxxxxxxxRU<br>(Russia)   | <a href="#">L10A Home Page</a>    |
| TC8300                     | TC83B0-x005A510NA<br>TC83B0-x005A61CNA<br>TC83BH-x205A710NA<br>TC83B0-x005A510RW<br>TC83B0-x005A61CRW<br>TC83BH-x205A710RW<br>TC83B0-x005A510IN<br>TC83B0-x005A61CIN<br>TC83BH-x205A710IN<br>TC83BH-x206A710NA<br><i>Note: 'x' Stands for wild card for<br/>different configurations</i> | TC83BH-x206A710RW<br>TC83B0-4005A610NA<br>TC83B0-4005A610RW<br>TC83B0-4005A610IN<br>TC83B0-5005A610NA<br>TC83B0-5005A610RW<br>TC83B0-5005A610IN<br>TC83B0-x005A510TA<br>TC83BH-x205A710TA | <a href="#">TC8300 Home Page</a>  |
| MC93                       | MC930B-GSXXG4XX<br>MC930P-GSXXG4XX<br>MC930P-GFXXG4XX<br><i>Note: 'x' Stands for wild card for<br/>different configurations</i>  | MC930B-GSXXG4NA-XX<br>MC930P-GSXXG4NA-XX  | <a href="#">MC9300 Home Page</a>  |
| VC8300                     | VC83-08FOCABAABA-I<br>VC83-08FOCQBAABA-I<br>VC83-08FOCQBAABANA<br>VC83-08SOCABAABA-I   | VC83-08SOCQBAABA-I<br>VC83-08SOCQBAABANA<br>VC83-08SOCQBAABAIN  | <a href="#">VC8300 Home Page</a>  |
| EC30                       | EC300K-1SA2ANA<br>EC300K-1SA2AA6<br>EC300K-1SA2AIA   | KT-EC300K-1SA2BNA-10<br>KT-EC300K-1SA2BA6-10  | <a href="#">EC30 Home Page</a>    |
| TC72                       | TC720L-0ME24B0-A6<br>TC720L-0ME24B0-NA   | TC720L-0ME24B0-TN<br>TC720L-0ME24B0-FT  | <a href="#">TC72 Home Page</a>    |

|                            |  |  |                                  |
|----------------------------|--|--|----------------------------------|
|                            | TC720L-0ME24B0-BR<br>TC720L-0ME24B0-IA   | TC720L-0MJ24B0-A6<br>TC720L-0MJ24B0-NA   |                                  |
| TC72 –<br>AR1337<br>Camera | TC720L-0MK24B0-A6<br>TC720L-0MK24B0-NA   | TC720L-0ML24B0-A6<br>TC720L-0ML24B0-NA   | <a href="#">TC72 Home Page</a>   |
| TC77                       | TC77HL-5ME24BG-A6<br>TC77HL-5ME24BD-IA<br>TC77HL-5ME24BG-FT<br>(FIPS_SKU)<br>TC77HL-7MJ24BG-A6<br>TC77HL-5ME24BD-ID<br>TC77HL-5ME24BG-EA<br>TC77HL-5ME24BG-NA  | TC77HL-5MG24BG-EA<br>TC77HL-6ME34BG-A6<br>TC77HL-5ME24BD-BR<br>TC77HL-5MJ24BG-A6<br>TC77HL-5ME24BG-RU<br>TC77HL-5MJ24BG-NA<br>TC77HL-7MJ24BG-NA                      | <a href="#">TC77 Home Page</a>   |
| TC77 –<br>AR1337<br>Camera | TC77HL-5MK24BG-A6<br>TC77HL-5MK24BG-NA   | TC77HL-5ML24BG-A6<br>TC77HL-5ML24BG-NA   | <a href="#">TC77 Home Page</a>   |
| TC57                       | TC57HO-1PEZU4P-A6<br>TC57HO-1PEZU4P-EA<br>TC57HO-1PEZU4P-IA  | TC57HO-1PEZU4P-BR<br>TC57HO-1PEZU4P-ID<br>TC57HO-1PEZU4P-NA  | <a href="#">TC57 Home Page</a>   |
| TC57 –<br>AR1337<br>Camera | TC57HO-1PFZU4P-A6  | TC57HO-1PFZU4P-NA  | <a href="#">TC57 Home Page</a>   |
| CC600                      | CC600-5-3200LNNA<br>CC600-5-3200LNWW<br>CC600-5-3200LNRU   | CC600-5-3200LNIN<br>CC600-5-3200LNCH   | <a href="#">CC600 Home Page</a>  |
| CC6000                     | CC6000-10-3200LCWW<br>CC6000-10-3200PCWW<br>CC6000-10-3200LCNA<br>CC6000-10-320NLCNA<br>CC6000-10-3200LCRU   | CC6000-10-3200PCNA<br>CC6000-10-3200LNNA<br>CC6000-10-320NLCWW<br>CC600-5-3200LNCH   | <a href="#">CC6000 Home Page</a> |
| WT6300                     | WT63B0-TS0QNERW<br>WT63B0-TS0QNENA<br>WT63B0-TX0QNERW<br>WT63B0-TX0QNENA<br>WT63B0-TS0QNETR  | WT63B0-KS0QNERW<br>WT63B0-KS0QNENA<br>WT63B0-KX0QNERW<br>WT63B0-KX0QNENA<br>WT63B0-TS0QNERU  | <a href="#">WT6300 Home Page</a> |
| MC2200                     | MC220J-2A3S2RW<br>MC220J-2A3S2NA<br>MC220J-2A3S2IN<br>MC220K-2B3S3RW<br>MC220K-2B3S3NA<br>MC220K-2B3S3IN<br>MC220K-2A3S3RW<br>MC220K-2B3S3TR<br>MC220J-2A3S2RU | MC220K-2B3S3IN01<br>MC220K-2A3S3RW<br>MC220K-2A3S3RW01<br>MC220K-2A3S3IN01<br>MC220J-2A3S2XP<br>MC220K-2B3S3XP<br>MC220J-2A3S2TR<br>MC220K-2B3S3RU<br>MC220K-2A3S3RU | <a href="#">MC2200 Home Page</a> |

|        |  |  |                                  |
|--------|--|--|----------------------------------|
| MC2700 | MC27AJ-2A3S2NA<br>MC27AK-2B3S3NA<br>MC27AK-4B3S3NA<br>MC27BJ-2A3S2RU<br>MC27BJ-2A3S2RW<br>MC27BJ-2A3S2TR<br>MC27BJ-2A3S2XP<br>MC27BK-2B3S3RU | MC27BK-2B3S3RW<br>MC27BK-2B3S3TR<br>MC27BK-2B3S3XP<br>MC27BK-4B3S3RW<br>MC27BJ-2A3S2BR<br>MC27BJ-2A3S2IN<br>MC27BK-2B3S3BR<br>MC27BK-2B3S3IN | <a href="#">MC2700 Home Page</a> |
| EC50   | EC500K-01B132-NA<br>EC500K-01B242-NA<br>EC500K-01B243-NA<br>EC500K-01D141-NA   | EC500K-01B243-A6<br>EC500K-01D141-A6<br>EC500K-01B132-A6<br>EC500K-01B242-A6   | <a href="#">EC50 Home Page</a>   |
| EC55   | EC55BK-21D141-A6<br>EC55BK-11B132-A6   | EC55BK-21B242-A6<br>EC55BK-21B243-A6   | <a href="#">EC55 Home Page</a>   |

## Addendum

### Component Versions

| Component / Description           | Version                               |
|-----------------------------------|---------------------------------------|
| Linux Kernel                      | 4.4.205                               |
| AnalyticsMgr                      | 2.4.0.1254                            |
| Android SDK Level                 | 29                                    |
| Audio (Microphone and Speaker)    | 0.31.0.0                              |
| Battery Manager                   | 1.1.7                                 |
| Bluetooth Pairing Utility         | 3.20                                  |
| Camera                            | 2.0.002                               |
| DataWedge                         | 8.2.211                               |
| EMDK                              | 9.0.3.3003                            |
| Files                             | 10                                    |
| License Manager and License Agent | version 5.0.0 and version 5.0.0.5.0.0 |
| MXMF                              | 10.3.0.18                             |
| NFC                               | NFC_NCIHALx_AR18C0.a.3.0              |

|                          |                         |
|--------------------------|-------------------------|
| OEM info                 | 9.0.0.315               |
| OSX                      | QCT.100.10.5.58         |
| RXlogger                 | 6.0.4.0                 |
| Scanning Framework       | 28.9.8.0                |
| StageNow                 | 5.1.0.1                 |
| WLAN                     | FUSION_QA_2_1.3.1.016_Q |
| Baseband                 | W210217A_014.1-00863    |
| Zebra Bluetooth Settings | 2.3                     |
| Zebra Data Service       | 10.0.1.1042             |

## Revision History

| Rev | Description     | Date           |
|-----|-----------------|----------------|
| 1.0 | Initial release | April 22, 2021 |