

Release Notes – Zebra Android 10

10-12-13.00-QN-U00-STD-HEL-04 Release (NGMS)

Highlights

This Android 10 NGMS release 10-12-13.00-QN-U00-STD-HEL-04 covers TC26, PS20, MC3300x, MC3300xR, TC52 family of products. Please see, Device Compatibility under Addendum Section for more details.

Software Packages

Package Name	Description
HE_FULL_UPDATE_10-12-13.00-QN-U00-STD-HEL-04.zip	Full Package Update
HE_EnterpriseReset_A10_V1.zip	Reset Package to Erase User Data Partition Only
HE_FactoryReset_ A10_V1.zip	Reset Package to Erase User Data and Enterprise Partitions

Security Updates

This build is Compliant up to Android Security Bulletin of May 05 2020.

Version Information

Below Table contains important information on versions

Description	Version
Product Build Number	10-12-13.00-QN-U00-STD-HEL-04
Android Version	10
Security Patch level	May 5, 2020
Linux Kernel	4.4.205
Component Versions	Please see Component Version under Addendum section



Device Support

Newly supported devices in this release: TC26, PS20, MC3300x, MC3300xR, TC52

This software release has been approved for use on the following devices.

Device Family	Part Number		Device Specific Manuals and Guides
TC26	TC26CK-12A222-CN	TC26CK-12A222-04	TC26 Home Page
PS20	PS20J-B2G2CN00	PS20J-P4G2CN00 PS20J-P4H2CN00	PS20 Home Page
MC3300x	MC330L-RL2EA4CN MC330L-RL3EA4CN MC330L-SJ3EA4CN MC330L-SJ4EA4CN MC330L-SK3EA4CN MC330L-SE3EA4CN MC330L-SE3EA4CN MC330L-GH3EA3CN	MC330L-GL3EA4CN MC330L-GJ2EA4CN MC330L-GE3EA4CN MC330L-SL3EA3CN MC330L-SH3EA3CN MC330L-GL3EA3CN	MC3300x Home Page
MC3300xR	MC339U-GF4EA4CN MC333U-GJ4EA4CN	MC339U-GE4EA4CN	MC3300xR Home Page
TC52	TC520K-2PEZU4P-CN		TC52 Home Page
TC52 HC	TC520K-2HEZU4P-CN		TC52 HC Home Page

New Features

- Added Support for VoIP for TC21
- Added support for MDNA licensing for TC26. For details refer to tech docs
 - o https://techdocs.zebra.com/licensing/about/#mdnacomponentsandfeatures
- Added support for DSDS feature (Dual Sim Dual Standby Auto selection) for TC26
- Added support for EB version 2.7.0.1 (licensed) for PS20.
- Added support for Ivanti Velocity (v2.1.9) for MC3300x.
- Added support for Multi-user for TC21
- Added support for pre-bundled PTT Express (Not Pre-Licensed). Not applicable for PS20.
- Added ability in DataWedge to block DataWedge API from being accessed by unknown applications.



- Added app consolidation feature where in the applications are bundled in 'zMonitor' and 'zConfigure' folders in the home screen.
- Added a feature wherein the Battery Manager and Battery Swap applications are combined into a single Battery Manager application.
- Added support for OTA update using AB streaming.
- Added support for SoftAP & WorryFreeWifi for TC21.
- Removed Device Diagnostic Tool application.
- Removed Device Central application.
- Removed support of legacy MC32 PowerPrecision batteries for MC3300x. The device will show a battery
 error message if the legacy MC32 battery is installed. The legacy MC32 PowerPrecision batteries will not be
 charged while installed in the MC3300x device.

Resolved Issues

- Resolved the issue wherein the device gets stuck at product logo screen when the settings application is hidden/disabled by MDMs.
- Resolved the intermittent issue wherein the microphone fails to function during a reboot.
- Resolved the issue wherein access permission to storage is denied when EMM agent is enrolled via QRCode.
- Resolved the issue wherein music playback stops on usb headset when device is suspended.
- Resolved the issue wherein the device gets stuck at update screen while adding the secondary user.
- Fixed: SPR38152 wherein BT friendly name (FN) of DX30 is not correctly displayed when paired.
- Fixed: SPR39592 wherein ENABLE_SCANER Intent along with BT disconnection causes invalid scanner to enable.
- Fixed: SPR39819 wherein extra line feed seen when action key character set as LF.
- Fixed: SPR39878 wherein DataWedge crashes when sending intents while it is starting up.
- Fixed: SPR39482 wherein an extra digit is being sent after every MSI barcode scan.
- Fixed: SPR39795 wherein timestamp is not returned on decoding dotcode barcodes.
- Fixed: SPR40076 wherein application crashes in the event of incorrect calling sequence of the Scanning APIs.
- Fixed: SPR38955 wherein application receives continuous back button events in case of press and hold back button and swipe.
- Fixed: SPR38800 wherein Osupdate fails with "bootlock Pin" when battery is below 30% and kept on charge.
- Fixed: SPR38800 wherein Wifi requires a reset when driver and the firmware are out of sync when the firmware does an FT Roam while the host is in suspend state.
- Fixed: SPR39260 wherein Bluetooth cannot be paired with ZQ320 & IMZ320
- Fixed: SPR39578 wherein Bluetooth paired with ZQ320 & IMZ320 cannot print.



- Fixed: SPR39613 wherein Bluetooth service discovery returns Null UUID.
- Fixed: SPR39514 wherein device gets a notification to enable google play, despite restricting GMS to Chrome from StageNow.
- Fixed: SPR39592 wherein BT pairing popup observed when RS60 is disconnected even when profile option is disabled.
- Fixed: SPR39878 wherein DW crash while processing intent from a third-party application.
- Fixed: SPR39522 wherein CTRL key on Physical keypad is responding with delay.
- Fixed: SPR39807 wherein 'Allow display over other apps' is not automatically set to enabled when installing WFC Voice.
- Fixed: SPR39879 wherein setting Clock CSP with EMDK changes the Time Zone but not time.

Usage Notes

None

Known Issues

- Picture quality of the image taken with 'Night Mode' in low-light conditions is poor.
- Trigger Modes: Presentation Read Mode is preferred over Continuous Read Mode. If using Continuous Read mode, use a lower illumination brightness setting (e.g. 2) to ensure the scanner can work without interruption.
- "Red Eye Reduction" feature disables the camera flash in the device hence, to enable the camera flash back please disable the red eye reduction feature.
- Fusion Advanced Logging fails to stop after performing OS Upgrade. Workaround is to keep Fusion Advanced Logging disabled before performing OS upgrade.
- SD card with total capacity more than 256GB cannot be formatted as internal storage (adopted storage).
- EMM does not support agent persistence in OS dessert downgrade scenario.
- When user attempts to do camera scanning in restricted profile of android multiuser mode device reboots.
- Reset packages of Oreo and Pie should not be used on devices running with A10 software.

Important Links

- Installation and setup instructions (if the link does not work please copy It to browser and try)
- Zebra Techdocs
- Developer Portal



Addendum

Component Versions

Component / Description	Version
Acoustic Profiles	TC26: General: SQ2.6 Cellular: SQ2.6 PS20: General: JQ1.2 Cellular: N/A MC3300x:General:DQ3.1,DQ3.0,DQ1.1,DQ1.0, DQ2.1,DQ2.0, RQ2.1,RQ1.1 Cellular: N/A TC52: General: GQ1.2, GQ2.2 Cellular: N/A
AnalyticsMgr	2.4.0.1254
Android SDK Level	29
Audio (Microphone and Speaker)	0.19.0.0
Battery App	1.1.4
Bluetooth Pairing Utility	3.17
Camera	2.0.002(50-00)
DataWedge	8.1.39
EMDK	8.1.6.2706
Enterprise Browser (PS20)	2.7.0.1
Files	10
License Manager and License Agent	version 4.0.2 and version 4.0.31.3.2.0
MXMF	10.1.0.33
NFC	NFC_NCIHALx_AR18C0.a.3.0
OEM info	9.0.0.170
OSX	QCT.100.10.3.28
RXlogger	6.0.3.0
Scanning Framework	27.4.19.0
StageNow	4.3.2.3



Touch Panel (FW)	06 (TC26) 08 (PS20) 38 (MC3300) 06 (TC52)
WLAN	FUSION_QA_2_1.1.0.003_Q
Zebra BlueTooth	2.5
Zebra Data Service	10.0.0.1175

Revision History

Rev	Description	Date
1.0	Initial release	June 23, 2020