



# Release Notes – Zebra Android 11

## 11-31-27.00-RG-U00-STD-HEL-04 Release (GMS)

### Highlights

This Android 11 GMS release 11-31-27.00-RG-U00-STD-HEL-04 covers EC30, EC50, EC55, ET51, ET56, L10A, MC2200, MC2700, MC3300x, MC3300xR, MC9300, TC21, TC21 HC, TC26, TC26 HC, TC52, TC52 HC, TC57, TC72, TC77, TC8300, WT6300, PS20J, CC600, CC6000 and VC8300 family of products.

LifeGuard patches are sequential and include all previous fixes that are part of earlier patch releases.

Please see, device compatibility under Addendum Section for more details.

### Software Packages

Package Name	Description
HE_FULL_UPDATE_11-31-27.00-RG-U00-STD-HEL-04.zip	Full package update
HE_DELTA_UPDATE_11-30-24.00-RG-U00-STD_TO_11-31-27.00-RG-U00-STD.zip	Delta package from previous release 11-30-24.00-RG-U00-STD
HE_DELTA_UPDATE_11-27-14.00-RG-U02-STD_TO_11-31-27.00-RG-U00-STD.zip	Delta Update package from previous release 11-27-14.00-RG-U02-STD-HEL-04 BSP version (Applicable only for PS20).
HE_DELTA_UPDATE_11-26-05.00-RG-U07-STD_TO_11-31-27.00-RG-U00-STD.zip	Delta Update package from previous release 11-26-05.00-RG-U07-STD-HEL-04 BSP version (Applicable only for CC6XX, VC83).

### Security Updates

This build is Compliant up to [Android Security Bulletin](#) of February 01, 2023

### LifeGuard Update 11-31-27.00-RG-U00

#### o New Features

- Added new feature called 'Reduced Settings with Accessibility' wherein Settings panel access will be limited to Display, Volume, About and Accessibility options.
- Programmatic method to retrieve KeyStates on Keyboard enabled devices (SHIFT)
- Added support for new digitizer in L10 device.
- ET51/ET56 & MC93 camera tuning parameter fixed for unstable auto-focus on rear camera.

- Added support for Zebra Charge Manager to improve the life of battery (not supported in L10A).

#### ○ Resolved Issues

- SPR47484 – Resolved an issue wherein volume would become low intermittently while using headset in WT6300 devices.
- SPR47522/47409 – Resolved an issue wherein poor voice quality was observed in VoLTE connections at Nordic carrier.
- SPR46422 – Resolved an issue wherein after performing long battery hot swap, ringer becomes silenced without notification after reboot.
- SPR47081 – Resolved an issue wherein USB port would remain powered on if device resume/suspend sequence was done in quick succession.
- SPR47303 – Resolved an issue wherein device info value was not appearing in resource0.csv.
- SPR47143 – Resolved an issue wherein few additional log messages were enabled in NFC component.
- SPR47874 – Resolved an issue wherein Shift and blue key combination was returning incorrect values.
- SPR47715 – Resolved an issue wherein Autofocus was not working properly.
- SPR47635 – Resolved an issue wherein both ENT and ENTER keys were returning same keycode.
- SPR47916 – Resolved an issue wherein downloads using Android Download Manager were failing at 1Mbps.
- SPR48128 – Resolved an issue wherein Access Manager CSP was reporting “Unable to Initialize” error while using WFC.
- SPR47436 – Resolved an issue where Power and Volume keys not working when Accessibility Service is enabled for an App.
- SPR47713/SPR47848 – Resolved an issue wherein intermittent one-way audio issues were observed with TEAMS App.
- SPR47457 – Resolved an issue wherein EMDK’s ProcessProfile API would fail if it was repeatedly executed.

#### ○ Usage Notes

- None

### **LifeGuard Update 11-30-24.00-RG-U00**

- This LG Delta Update package is applicable for 11-26-05.00-RG-U07-STD-HEL-04 BSP version (Applicable except PS20, CC6XXX, VC83, MC20, RZ-H271).

#### ○ New Features

- Added root detection service support for SD660 A11.
- Added new MX feature to support "Do not validate" option for CA certificate.
- Added new MX feature Host Mode Peripherals: Controls whether to allow all USB peripherals to be used when the device is in USB Host Mode or to restrict usage to peripherals as defined in Rules created by the administrator using the Custom Rules parameter.
- Added new MX feature to support TouchService to allow EMM to configure Haptic Feedback on device.
- RXlogger : Meminfo support in RxLoggerUtility.
- RXlogger : The ability to configure log path for all RxLogger modules is now enabled.
- Oeminfo : Added support for querying SIM EID.
- SKT WWAN certification completed in South Korea.
- MTN WWAN certification completed in South Africa.
- Added allow Battery-Swap with Legic accessory is connected to TC7X in BatteryManager.

- TC7x Legic accessory support and on attaching device NFC will be disabled.
- Added support for new digitizer in L10 device.
- **Datawedge** Added Timed Continuous Trigger Mode on all products.
- **Datawedge** Enabled BT Trigger Remap Feature for MC93 Galactus
- **Datawedge** Added OCR Wedge features - Phase-3 (Container mode, performance optimization)
  - **Datawedge** Added new OCR Wedge version "7.0.0"
  - **Datawedge** OCR Wedge features - Tire Size and Commercial Tire ID support
  - **Datawedge** OCR Wedge features Phase 3 - Localization support for features added in Phase 3
  - **Datawedge** OCR Wedge - Localization support for extended TIN features parameters
- **Datawedge** Added LED Feedback and Hardware Beep feedback support for OCR Wedge features.
- **Datawedge** Expose Country for OCR Wedge License Plate feature.
- **Datawedge** Added support for "Zebra USB Scanner" and "Zebra USB Cradle" for TC21/TC26
- **Datawedge** Released New Firmware – "CAAFZS00-001-R00" for SE965 Scan Engine.
- Added support for Corded Adapter (CBL-RS5X6-ADPWT-01) in WT6300 for RS5100, RS6100.
- Added support for RS6100 Ring Scanner.
- Ability to disable the on-screen mute option in Zebra Volume Control (ZVC).

#### ○ Resolved Issues

- SPR46809 – Resolved an issue in Datawedge wherein OCR functionality was not working failing unless text was rotated at 180 degrees.
- SPR46513 -- Resolved an issue in Datawedge wherein Enter key char was not being sent.
- SPR46061 -- Resolved an issue in Datawedge wherein invoking GetConfig API was resulting in exception.
- SPR45277 -- Resolved an issue wherein noise and cracking sound was observed on EC55 during voice calls in SWB.
- SPR45016 -- Resolved an issue wherein disabling status bar via MX was not hiding/blocking the status bar completely when used with full screen Apps.
- SPR46530 – Resolved an issue in AppMgr wherein Installing an App using AppMgr Upgrade option was failing in 11.20.18 build onwards.
- SPR47289 – Resolved an issue in KeyRemapping wherein Diamond key was not persisting across reboot.
- SPR46586 -- Resolved an issue wherein user was unable to set EHS as default launcher using Stage Now.
- SPR46771 – Resolved an issue wherein launching Battery Manager App though intent was not working.
- SPR46244 – Resolved an issue wherein soft navigation panel key were less responsive.
- SPR47350 – Resolved an issue wherein Velocity App updated via play store was getting deleted post an OS update on a device enrolled with MS INTUNE.
- SPR47301/SPR46016 -- Resolved an issue wherein USB connection would not work post suspend and resume when RFD40 was connected to the device.
- SPR46991/SPR47343 -- Resolved an issue wherein NFC functionality was impacted on WT6300 after updating to Lifeguard that included an updated NFC firmware.
- SPR47126/SPR48202 -- Resolved an issue wherein certain VOIP clients that use Telephony Manager APIs were not working on WIFI only devices.
- SPR47101 -- Resolved an issue wherein camera fails to launch.
- SPR46918 - Resolved an issue of choppy voice quality for WiFi-6 capable devices.

#### ○ Usage Notes

- L10A devices with new display ZBR\_R47 and digitizer(ro.config.device.digitizer=1) require 11-30-24.00-RG-U00-STD-HEL-04 or higher to ensure full Digitizer functionality.
  - To identify display type, users can check 'ro.config.device.display' property using getprop command from adb.
    - Devices with new display ZBR\_R47 will have [ro.config.device.display]: [513]
  - To identify digitizer device type, users can check 'ro.config.device.digitizer' property using getprop command from adb.
    - Devices with digitizer will have [ro.config.device.digitizer]: [1]
    - Devices with without digitizer will have [ro.config.device.digitizer]: [0]
  - User can identify the digitizer firmware version from settings.
    - Settings -> About Phone -> SW components -> Digitizer FW Version 2140
    - 2140 is new Digitizer value.

### **LifeGuard Update 11-27-14.00-RG-U02 (Applicable only for PS20)**

- LifeGuard Update 11-27-14.00-RG-U02 contains security updates only.
- This LG Delta Update package is applicable for 11-27-14.00-RG-U01-STD-HEL-04 BSP version.
  - **New Features**
    - None
  - **Resolved Issues**
    - None
  - **Usage Notes**
    - None

### **LifeGuard Update 11-26-05.00-RG-U07 (Applicable except PS20)**

- LifeGuard Update 11-26-05.00-RG-U07 contains security updates only.
- This LG Delta Update package is applicable for 11-26-05.00-RG-U05-STD-HEL-04 BSP version.
  - **New Features**
    - None
  - **Resolved Issues**
    - None
  - **Usage Notes**
    - None

### **LifeGuard Update 11-27-14.00-RG-U01 (Applicable only for PS20)**

- LifeGuard Update 11-27-14.00-RG-U01 contains security updates only.
- This LG Delta Update package is applicable for 11-27-14.00-RG-U00-STD-HEL-04 BSP version.
  - **New Features**
    - None
  - **Resolved Issues**
    - None
  - **Usage Notes**
    - None

### **LifeGuard Update 11-26-05.00-RG-U05 (Applicable except PS20)**

- LifeGuard Update 11-26-05.00-RG-U05 contains security updates only.
- This LG Delta Update package is applicable for 11-26-05.00-RG-U04-STD-HEL-04 BSP version.
  - **New Features**
    - None
  - **Resolved Issues**
    - None
  - **Usage Notes**
    - None

### **LifeGuard Update 11-27-14.00-RG-U00 (Applicable only for PS20)**

- This LG Delta Update package is applicable for 11-26-05.00-RG-U02-STD-HEL-04 BSP version.
  - **New Features**
    - None
  - **Resolved Issues**
    - Fixed intermittent abnormal display behavior during initial device bootup on Zebra splash screen.
  - **Usage Notes**
    - None

## LifeGuard Update 11-26-05.00-RG-U04 (Applicable except PS20)

- LifeGuard Update 11-26-05.00-RG-U04 contains security updates only.
- This LG Delta Update package is applicable for 11-26-05.00-RG-U02-STD-HEL-04 BSP version.
  - **New Features**
    - None
  - **Resolved Issues**
    - None
  - **Usage Notes**
    - None

## LifeGuard Update 11-26-05.00-RG-U02

- LifeGuard Update 11-26-05.00-RG-U02 contains security updates only.
- This LG patch is applicable for 11-26-05.00-RG-U00-STD-HEL-04 BSP version.
  - **New Features**
    - None
  - **Resolved Issues**
    - None
  - **Usage Notes**
    - None

## LifeGuard Update 11-26-05.00-RG-U00

- This LG Delta Update package is applicable for 11-23-13.00-RG-U07-STD-HEL-04 BSP version.
  - **New Features**
    - TMO (USA) WWAN certification completed.
    - DCM Regulatory country approval received.
    - PAAFNS00-001-R04 firmware is integrated for SE5500 Scan Engine in Datawedge.
    - Added New Workflow for Document Capture with Border highlighting/document fill in Datawedge.
    - Added fix for image capture where preview is inverted on MC9300 SE4850 scan engine in Datawedge.
    - Added localization support for Workflow input parameters in Datawedge.
      - Supported languages - German, French, Spanish, Italian, Traditional Chinese, Simplified Chinese and Japanese.
    - Added support for “Zebra USB Cradle” (USB cradle w/ Bluetooth Scanner) in Datawedge.

- Added support for scanning using new Workstation cradles for the USB scanners and USB cradles in Datawedge.
- Added support for TWT in Fusion for use cases that have infrequent/intermittent traffic. It is not Enabled Out of Box and can be enabled using Stage Now/MDM.
- Added support for CCX in Fusion for Data Use Cases. It is not Enabled Out of Box and can be enabled using Stage Now/MDM.
- WPA3 Roam behavior Enhancements in Fusion.
- Added new MX feature to support to programmatically retrieve key states on keyboard enabled devices.
- Added new MX feature to support for Bluetooth\_Remote\_Trigger feature on All SDM660 devices.
- Added new MX feature to support to control whether the device user is prompted to interact with newly inserted SD Card into the device.
- Added new MX feature to support to automatically turn off Airplane Mode after a length of time as configured in the Airplane Mode Timer parameter.
- Added new MX feature to support to select the subsystem on the device to apply the permission being assigned to an app by the Permission Access Action parameter.
- Added support for querying touch mode and WLAN properties in OEM Info.
- Added support for “meminfo -s” command for Snapshot Module in RxLogger.
- Added support the new Schema changes in OemConfig.
- Added support to transfer Device Ownership from one device to other device owner, feature can be used to transfer StageNow device owner to any other device owner application.
- Added support to enable Battery part number BT-000362-50/BT-000262-A0 in WT6300. This will allow the battery to charge in low temperature (2 deg C and above).

## o Resolved Issues

- SPR 46494 – Fixed issue in Code ID Symbol for GS1 Data Matrix barcodes.
- SPR 45935 – Fixed an intermittent scan failure on the MC2700 with SE4100.
- SPR 45951 – Added Support for additional countries.
- SPR 44971 – Resolved an issue wherein BT Audio gateway codec was not working at 8kHz.
- SPR46370 – Resolved an issue wherein Beep action setting under Advanced data formatting in Data wedge was not getting listed when device language was set to Japanese.
- SPR45464 – Resolved an issue wherein touches/taps around bottom area of the screen was not very responsive on MC33x devices.
- SPR44932 – Resolved an issue wherein battery level wouldn't go up to full level while devices were in charging and were reporting different battery levels.
- SPR 46220 – Resolved an issue wherein intermediate files were being retained along with snoop logs when BT Snoop logging was enabled in Rxlogger.
- SPR 46513 – Resolved an issue wherein Char 13 was not being sent via Send Char ADF option after updating to DW 11.3.28.
- SPR 45016 – Resolved an issue wherein disabling status bar via MX was not hiding/blocking the status bar completely when used with full screen Apps.
- SPR 46162 – Resolved an issue wherein user was not able to use USB keyboard when access to USB storage from computer was disabled using MX Access Mgr.
- SPR 46516 – Resolved an issue wherein AudioVolUIMgr settings were not persisting after Enterprise Reset.
- SPR 45657 – Resolved an issue wherein RFID antenna type was not configured correctly resulting in lower regulatory ranges for certain country setting.
- SPR46892 – Resolved an issue wherein devices were randomly getting stuck in password dialog upon reboot after updating from A8 to A11.
- SPR 47012 – Change default state of CCKM to disabled.
- SPR 46530 – Resolved an issue wherein Apps were not getting installed via AppMgr using Upgrade option.

- SPR 46195 – Resolved an issue wherein USB hub intermittently fails to resume from suspend.

- **Usage Notes**

- Touch Mode system property has changed in A11. Please use the following OEMInfo URI - "content://oem\_info/oem.zebra.software/persist.sys.touch\_mode"
- TC83 & MC93 DPM SKUs should not be downgraded to A11 BSPs below 11-26-05.00-RG-U00-STD-HEL-04.
  - To identify if the device is having DPM SKU please browse the below location in the settings UI  
settings->about phone->software components->scanner->SE4750 (DP)  
settings->about phone->software components->scanner->SE4750 (DPW)

## **LifeGuard Update 11-23-13.00-RG-U07**

- LifeGuard Update 11-23-13.00-RG-U07 contains security updates only.
- This LG Delta Update package is applicable for 11-23-13.00-RG-U01-STD-HEL-04 BSP version.

- **New Features**

- None

- **Resolved Issues**

- None

- **Usage Notes**

- None

## **LifeGuard Update 11-23-13.00-RG-U01**

- LifeGuard Update 11-23-13.00-RG-U01 contains security updates only.
- This LG patch is applicable for 11-23-13.00-RG-U00-STD-HEL-04 BSP version.

- **New Features**

- None

- **Resolved Issues**

- None

- **Usage Notes**

- None



## LifeGuard Update 11-23-13.00-RG-U00

- This LG Delta Update package is applicable for 11-20-18.00-RG-U02-STD-HEL-04 BSP version.

### ○ New Features

- Added new Soft Trigger API to start, stop or toggle a software trigger for voice input in DataWedge.
- Deprecated the following Voice Input features in DataWedge:
  - Data capture start option - Start phrase
  - Data capture start phrase
  - Data capture end phrase
- Zebra recommends transitioning to using the PTT button to trigger voice capture.
- Added New Data capture start option in DataWedge to trigger voice capture only via intent API.
- Added new MX feature to support for configuration of the “Power off” menu item on Power Key Menu.
- Added new MX feature which Allow/Disallow switch for controlling whether display and touch panel are turned on/off based on device proximity to a human face during an call.
- Added new MX feature which allows ability to set custom dialer application which provides administrators a systematic way to set a calling application to be used as a default caller.
- Added support for new display ZBR\_R47.
- Added support for new touch EXC86H82.
- Added support for RFD40 RFID Sled for TC52AX Rear I/O.

### ○ Resolved Issues

- SPR44338 – Resolved an issue wherein scanned barcode data was intermittently getting reported incorrectly.
- SPR45265 – Resolved an issue wherein RFID Wedge App was not working on L10 running A10 and above.
- SPR45376 – Resolved an issue wherein trigger button was emitting beam even after it was remapped to a different key.
- SPR45638 – Resolved an issue wherein User was not able to set DTR state using EMDK Application.
- SPR46167 – Resolved an issue wherein device was not connecting back even though it was within range.
- SPR46405 – Resolved an issue wherein user was unable to Unpair the Bluetooth devices using Device Central on devices running with 11-20-18.00-RG-U00-STD-HEL-04 Build.
- SPR46483 - Resolved an issue wherein StageNow My Lifeguard Updates are failing to apply to BSPs 11-20-18 U00 and 11-20-18 U02.

### ○ Usage Notes

- L10A devices with new display ZBR\_R47 and touch EXC86H82 cannot be downgraded to BSPs below 11-20-18.00-RG-U00-STD-HEL-04.

To identify display type, users can check ‘ro.config.device.display’ property using getprop command from adb.

- Devices with new display ZBR\_R47 will have [ro.config.device.display]: [513]
- Devices with display EP101R1912N1000TG will have [ro.config.device.display]: [2001]

To identify touch type, users can check ‘ro.config.device.touch’ property using getprop command from adb.

- Devices with new touch EXC86H82 will have [ro.config.device.touch]: [32770]
- Devices with touch EXC3161 will have [ro.config.device.touch]: [32768]

## LifeGuard Update 11-20-18.00-RG-U02

- LifeGuard Update 02 contains security updates only.
- This LG Delta Update package is applicable for 11-20-18.00-RG-U00-STD-HEL-04 BSP version.

- **New Features**

- None

- **Resolved Issues**

- None

- **Usage Notes**

- None

## LifeGuard Update 11-20-18.00-RG-U00

- This LG Delta Update package is applicable for 11-20-18.00-RG-U00-STD-HEL-04 BSP version.

- **New Features**

- Added support for Friendly Zebra Scanner Interface for seamless support of Zebra Bluetooth and USB Scanners via Scan Framework & Datawedge.
- Added Mobility DNA OCR Wedge v1 Early Access (Camera Only) family of licensed configurations.
  - Tire Identification Number (TIN)
  - Identification Documents (ID)
  - License Plate
  - Meter Reading
  - Vehicle Identification Number (VIN)
- Added Datawedge support for Free-Form Image Capture (Camera/Imager)
- Added Datawedge support for Barcode Highlighting (Camera/Imager)
- Added support for Multi-Barcode – Minimum count & timeout duration to support decoding a changing number of barcodes.
- Added Datawedge support for Scan QR Code to Launch a Link.
- Added Datawedge Support for handling notifications for license updates (Activate & Deactivate). Third party agent will be notified immediately when the license status gets changed.
- SE5500 GA Release
- Added new MX feature to give admin complete control over the quick settings tiles.
- Added new MX feature for Battery Saver and Vibration Control.
- Added new MX feature for Dark Theme ON/OFF option.
- Added support for Signing Key Change to Support App Bundles.
- Added support for interface check before doing G-ARP.
- Added support for Save and restore to preserve the previous setting performed by KTI APIs.

- Added support for improved noise reduction on phones calls using Bluetooth connection
- Added support for pause and resume feature in FOTA client.
- Added support for LGE 3.0 A/B Streaming.
- Added support for Persist MDNA Enterprise Upgrade License.
- Updated the new launcher icon and splash screen for VOD app and fixed an issue related to Back button which was opening and displaying the videos even after pressing back button to exit the application.
- Added support for BMI270/ICM42607 Gyroscope/accelerometer Sensors.
- This release support TC52ax HC product.

## ○ Resolved Issues

- SPR45099 – Resolved an issue wherein the check digit rule was not working as expected on MSI barcode symbology with newer ZBACK scanner.
- SPR45159 – Resolved an issue wherein DisAllowApplicationUpgrade was leading to Apps getting crashed.
- SPR44942 – Merged additional touch configurations to handle different touch configurations.
- SPR44618 and SPR44765 – Resolved an issue wherein Audio was intermittently getting routed via device mic instead of BT headset.
- SPR44619 – Fixed an issue of Ghost screen touches.
- SPR44265 – Fixed an issue of BT showing incorrect battery usage in bug report.
- SPR44833 – Fixed an issue of 'EthernetMgr' manual proxy config not working.
- Fixed Zebra Pay PD20 timer issue.
- Fixed Settings ANR issues
- Fixed RxLogger EOF issue
- Fixed WPA3-SAE compatibility with CISCO AP
- Fixed Voice quality and Stability enhancement

## ○ Usage Notes

- BMI270/ICM42607 Gyroscope/accelerometer sensor devices require 11-20-18.00-RG-U00-STD or higher to ensure full G-sensor functionality.
- The installed Gyroscope/Accelerometer sensors can be identified either in SETTINGS or via ADB command:

### Settings:

- a. Devices with BMI270/ ICM42607 Gyroscope/accelerometer sensor will list sensor type as BMI270/ ICM42607 on "Settings-->About phone-->SW components-->Gyroscope" or "Settings-->About phone-->SW components -->Accelerometer".

### ADB:

Check the ro.config.device.gyro & ro.config.device.accelerometer property using getprop command from adb.

- a. Devices with BMI270 Gyroscope/accelerometer sensor will have ro.config.device.gyro = 32  
ro.config.device.accelerometer=120
- b. Devices with ICM42607 Gyroscope/accelerometer sensor will have ro.config.device.gyro = 260  
ro.config.device.accelerometer=2052

## Version Information

Below Table contains important information on versions

Description	Version
Product Build Number	11-31-27.00-RG-U00-STD-HEL-04
Android Version	11
Security Patch level	February 01, 2023
Component Versions	Please see Component Versions under Addendum section

## Device Support

The products supported in this release are EC30, EC50, EC55, ET51, ET56, L10A, MC2200, MC2700, MC3300x, MC3300xR, MC9300, TC21, TC21 HC, TC26, TC26 HC, TC52, TC52 HC, TC57, TC72, TC77, TC8300, WT6300, PS20J, CC600, CC6000 and VC8300 family of products.

Please see device compatibility details under Addendum Section.

## Known Constraints

- In-order to avoid any inconsistencies in Settings UI it is recommended to wait for a few seconds after the device boots up before launching settings UI.
- On upgrading a device from A8/A9/A10 to A11, NFC manager configuration need to be re-applied.
- Starting Android 11 on SDM660, an UPL file cannot consist of both Full OTA and Delta OTA package. On A11 customer can directly install the Full OTA package of required LG image
- One second Bluetooth jitter noticed in 2.4GHz band.
- Ethernet UI is accessible from settings despite being disabled.
- RxLogger fails to store logs in internal storage when external SDCard is formatted as internal/adaptable, or it is ejected during run time.
- BLE FW update will not work without enabling location service under settings.
- When working with files on the Desktop, using mouse-drag to select, move and/or copy files causes some file management apps to crash. Zebra recommends using right-click copy and paste functions instead.
- "Always-ON VPN" is grayed out for IKEv2-RSA/PSK/MSCHAPv2 after a reboot. User will have to manually select 'VPN on' to activate the VPN.

## Important Links

- [Installation and setup instructions](#) (if the link does not work, please copy It to browser and try)

- [Zebra Techdocs](#)
- [Developer Portal](#)

## Addendum

### Device Compatibility

This software release has been approved for use on the following devices.

Device Family	Part Number		Device Specific Manuals and Guides
CC600	CC600-5-3200LNNA CC600-5-3200LNWW	CC600-5-3200LNIN	<a href="#">CC600 Home Page</a>
CC6000	CC6000-10-3200LCWW CC6000-10-3200PCWW CC6000-10-3200LCNA CC6000-10-320NLCNA	CC6000-10-3200PCNA CC6000-10-3200LNNA CC6000-10-320NLCWW	<a href="#">CC6000 Home Page</a>
EC30	EC300K-1SA2ANA EC300K-1SA2AA6 EC300K-1SA2AIA	KT-EC300K-1SA2BNA-10 KT-EC300K-1SA2BA6-10	<a href="#">EC30 Home Page</a>
EC50	EC500K-01B132-NA EC500K-01B242-NA EC500K-01B243-NA EC500K-01D141-NA EC500K-01B112-NA EC500K-01B222-NA EC500K-01B223-NA EC500K-01D121-NA EC500K-01B112-IA EC500K-01B112-RU EC500K-01B112-TR EC500K-01B112-XP EC500K-01D121-IA EC500K-01D121-RU	EC500K-01B243-A6 EC500K-01D141-A6 EC500K-01B132-A6 EC500K-01B242-A6 EC500K-01B112-A6 EC500K-01B222-A6 EC500K-01B223-A6 EC500K-01D121-A6 EC500K-01B223-IA EC500K-01B223-RU EC500K-01B223-TR EC500K-01B223-XP EC500K-01D121-TR EC500K-01D121-XP	<a href="#">EC50 Home Page</a>
EC55	EC55AK-01B112-NA EC55AK-11B112-NA EC55AK-11B132-NA EC55AK-21B222-NA EC55AK-21B223-NA EC55AK-21B242-NA EC55AK-21B243-NA EC55AK-21D121-NA EC55AK-21D141-NA EC55AK-21D221-NA EC55BK-01B112-A6	EC55BK-11B223-A6 EC55BK-21B222-A6 EC55BK-21B223-A6 EC55BK-21B223-BR EC55BK-21B223-IA EC55BK-21B223-ID EC55BK-21B223-XP EC55BK-21B242-A6 EC55BK-21B243-A6 EC55BK-21D121-A6 EC55BK-21D121-BR	<a href="#">EC55 Home Page</a>

	<p>EC55BK-11B112-A6          EC55BK-11B112-BR          EC55BK-11B112-IA          EC55BK-11B112-ID          EC55BK-11B112-XP          EC55BK-11B132-A6          EC55BK-21D121-RU</p>	<p>EC55BK-21D121-IA          EC55BK-21D121-ID          EC55BK-21D121-XP          EC55BK-21D141-A6          EC55BK-11b112-RU          EC55BK-21B223-RU</p>	
ET51	<p>ET51CT-G21E-00A6          ET51CT-G21E-00NA          ET51CE-G21E-00NA          ET51CE-G21E-00A6</p>	<p>ET51CE-G21E-00IA          ET51CE-G21E-SFA6          ET51CE-G21E-SFNA</p>	<a href="#">ET51 Home Page</a>
ET56	<p>ET56DT-G21E-00NA          ET56ET-G21E-00A6          ET56ET-G21E-00IA</p>	<p>ET56DE-G21E-00A6          ET56DE-G21E-00NA</p>	<a href="#">ET56 Home Page</a>
L10A	<p>RTL10B1-xxxxxxxxxNA          (North America)          RTL10B1-xxAxxX0x00A6          (ROW)          Note: 'x' Stands for wild card          for different configurations</p>	<p>RTL10B1-xxAxxX0x00IN          (India)</p>	<a href="#">L10A Home Page</a>
MC2200	<p>MC220K-2A3S3RW          MC220K-2A3E3NA01          MC220K-2A3E3IN01          MC220K-2A3E3RW01          MC220K-2B3E3RW          MC220K-2B3S3RW          MC220K-2B3S3NA          MC220K-2B3S3IN          MC220K-2B3S3RU          MC220K-2B3S3TR</p>	<p>MC220K-2B3S3XP          MC220K-2A3S3RU          MC220J-2A3S2RW          MC220J-2A3S2NA          MC220J-2A3S2IN          MC220J-2A3S2XP          MC220J-2A3S2RU          MC220J-2A3E2RU          MC220J-2A3S2TR</p>	<a href="#">MC2200 Home Page</a>
MC2700	<p>MC27AK-2B3S3NA          MC27AK-4B3S3NA          MC27BJ-2A3S2ID          MC27BJ-2A3S2IN          MC27BJ-2A3S2RW          MC27BJ-2A3S2XP          MC27BK-2B3S3ID          MC27BK-2B3S3IN</p>	<p>MC27BK-2B3S3RW          MC27BK-2B3S3XP          MC27BK-4B3S3RW          MC27BJ-2A3S2TR          MC27BK-2B3S3TR          MC27AJ-2A3S2NA</p>	<a href="#">MC2700 Home Page</a>
MC3300x	<p>MC330L-GE2EG4NA          MC330L-GE2EG4RW          MC330L-GE3EG4IN          MC330L-GE3EG4NA          MC330L-GE3EG4RW          MC330L-GE4EG4IN          MC330L-GE4EG4NA          MC330L-GE4EG4RW          MC330L-GJ2EG4NA</p>	<p>MC330L-SC2EG4NA          MC330L-SC2EG4RW          MC330L-SC3EG4NA          MC330L-SC3EG4RW          MC330L-SC4EG4NA          MC330L-SC4EG4RW          MC330L-SE2EG4NA          MC330L-SE2EG4RW          MC330L-SE3EG4NA</p>	<a href="#">MC3300x Home Page</a>

	<p>MC330L-GJ2EG4RW  MC330L-GJ3EG4IN  MC330L-GJ3EG4NA  MC330L-GJ3EG4RW  MC330L-GJ4EG4IN  MC330L-GJ4EG4NA  MC330L-GJ4EG4RW  MC330L-GL2EG4NA  MC330L-GL2EG4RW  MC330L-GL3EG4IN  MC330L-GL3EG4NA  MC330L-GL3EG4RW  MC330L-GL4EG4IN  MC330L-GL4EG4NA  MC330L-GL4EG4RW  MC330L-RC2EG4NA  MC330L-RC2EG4RW  MC330L-RC3EG4NA  MC330L-RC3EG4RW  MC330L-RC4EG4NA  MC330L-RC4EG4RW  MC330L-RL2EG4NA  MC330L-RL2EG4RW  MC330L-RL3EG4NA  MC330L-RL3EG4RW  MC330L-RL4EG4NA  MC330L-RL4EG4RW  MC330L-SA2EG4NA  MC330L-SA2EG4RW  MC330L-SA3EG4IN  MC330L-SA3EG4NA  MC330L-SA3EG4RW  MC330L-SA3EG4TR  MC330L-SA4EG4IN  MC330L-SA4EG4NA  MC330L-SA4EG4RW  MC330L-SA4EG4TR</p>	<p>MC330L-SE3EG4RW  MC330L-SE4EG4NA  MC330L-SE4EG4RW  MC330L-SG2EG4NA  MC330L-SG2EG4RW  MC330L-SG3EG4IN  MC330L-SG3EG4NA  MC330L-SG3EG4RW  MC330L-SG3EG4TR  MC330L-SG4EG4NA  MC330L-SG4EG4RW  MC330L-SG4EG4TR  MC330L-SJ2EG4NA  MC330L-SJ2EG4RW  MC330L-SJ3EG4IN  MC330L-SJ3EG4NA  MC330L-SJ3EG4RW  MC330L-SJ4EG4IN  MC330L-SJ4EG4NA  MC330L-SJ4EG4RW  MC330L-SK2EG4NA  MC330L-SK2EG4RW  MC330L-SK3EG4NA  MC330L-SK3EG4RW  MC330L-SK4EG4NA  MC330L-SK4EG4RW  MC330L-SL2EG4NA  MC330L-SL2EG4RW  MC330L-SL3EG4NA  MC330L-SL3EG4RW  MC330L-SL4EG4NA  MC330L-SL4EG4RW  MC330L-SM2EG4NA  MC330L-SM2EG4RW  MC330L-SM3EG4NA  MC330L-SM3EG4RW  MC330L-SM4EG4NA  MC330L-SM4EG4RW</p>	
<p>MC3300xR</p>	<p>MC333U-GJ2EG4EU  MC333U-GJ2EG4IL  MC333U-GJ2EG4JP  MC333U-GJ2EG4US  MC333U-GJ3EG4EU  MC333U-GJ3EG4US  MC333U-GJ4EG4EU  MC333U-GJ4EG4IN  MC333U-GJ4EG4JP  MC333U-GJ4EG4SL  MC333U-GJ4EG4TH  MC333U-GJ4EG4US  MC333U-GJ4EG4WR  MC339U-GE2EG4EU  MC339U-GE2EG4JP</p>	<p>MC339U-GE3EG4US  MC339U-GE4EG4EU  MC339U-GE4EG4IN  MC339U-GE4EG4JP  MC339U-GE4EG4TH  MC339U-GE4EG4US  MC339U-GE4EG4WR  MC339U-GF2EG4EU  MC339U-GF2EG4US  MC339U-GF3EG4EU  MC339U-GF3EG4TH  MC339U-GF3EG4US  MC339U-GF4EG4EU  MC339U-GF4EG4SL  MC339U-GF4EG4TH</p>	<p><a href="#">MC3300xR Home Page</a></p>

	MC339U-GE2EG4US MC339U-GE2EG4WR MC339U-GE3EG4EU		MC339U-GF4EG4US MC339U-GF4EG4WR	
MC93	MC930B-GSXXG4XX MC930P-GSXXG4XX MC930P-GFXXG4XX Note: 'x' Stands for wild card for different configurations		MC930B-GSXXG4NA-XX MC930P-GSXXG4NA-XX	<a href="#">MC9300 Home Page</a>
PS20	PS20J-P4G1A600 PS20J- P4G1A600-10 PS20J- B2G1A600 PS20J- B2G1A600-10 PS20J- P4H1A600 PS20J- P4H1A600-10 PS20J- B2G2CN00 PS20J- P4H2CN00 PS20J-		PS20J-P4G2CN00 PS20J- P4G1NA00 PS20J- P4G1NA00-10 PS20J- B2G1NA00 PS20J- B2G1NA00-10 PS20J- P4H1NA00 PS20J- P4H1NA00-10 PS20J-	<a href="#">PS20 Home Page</a>
TC21	TC210K-01A222-A6 TC210K-01A242-A6 TC210K-01D221-A6 TC210K-01D241-A6 TC210K-01B212-A6 TC210K-01B232-A6 TC210K-01A422-A6 TC210K-01A442-A6 TC210K-0HD224-A6 TC210K-0HB224-A6 TC210K-0HB222-A6 TC210K-01A423-A6 TC210K-0JB224-A6 TC210K-01B422-NA TC210K-01A222-NA TC210K-01D221-NA TC210K-01D241-NA TC210K-0JD224-NA TC210K-0JB224-NA TC210K-01A242-NA TC210K-01A442-NA		TC210K-01A423-NA TC210K-0HD224-NA TC210K-0HB224-NA TC210K-0HB222-NA TC210K-01A422-NA TC210K-0HB224-IA TC210K-01A222-IA TC210K-01A242-IA TC210K-01A442-IA TC210K-01A422-IA TC210K-01B212-IA TC210K-01B232-IA TC210K-01A423-IA TC210K-01B232-TR TC210K-01B212-TR TC210K-01D221-TR TC210K-01D241-TR TC210K-0HD224-FT TC210K-01B212-XP TC210K-01B212-NA TC210K-01B232-NA	<a href="#">TC21 Home Page</a>
TC21 HC	TC210K-0HD224-NA KT-TC210K-0HD224-FT TC210K-0HD224-A6 TC210K-0HB224-A6 TC210K-0JB224-A6 TC210K-0JD224-NA TC210K-0JB224-NA TC210K-0HB224-NA TC210K-0HB222-NA TC210K-0HB224-IA TC210K-0HB222-NA KT-TC210K-0HD224- PTTP1-NA		KT-TC210K-0HB224- PTTP1-A6 KT-TC210K-0HB224- PTTP2-A6 KT-TC210K-0HD224-WFC1- NA KT-TC210K-0HD224-WFC2- NA KT-TC210K-0HD224-WFC1- FT KT-TC210K-0HD224-WFC2- FT	<a href="#">TC21 Home Page</a>



	KT-TC210K-0HD224-PTTP2-NA KT-TC210K-0HD224-PTTP1-FT KT-TC210K-0HD224-PTTP2-FT KT-TC210K-0HD224-PTTP1-A6 KT-TC210K-0HD224-PTTP2-A6	KT-TC210K-0HD224-WFC1-A6 KT-TC210K-0HD224-WFC2-A6 KT-TC210K-0HB224-WFC1-A6 KT-TC210K-0HB224-WFC2-A6	
TC26	TC26BK-11A222-A6 TC26BK-11A242-A6 TC26BK-11A422-A6 TC26BK-11A423-A6 TC26BK-11A442-A6 TC26BK-11B212-A6 TC26BK-11B232-A6 TC26BK-11B412-A6 TC26BK-11D221-A6 TC26BK-11D241-A6 TC26BK-11D421-A6 TC26BK-21D221-A6 TC26BK-21A222-A6 TC26BK-1HB224-A6 TC26BK-1HD224-A6 TC26BK-1JB224-A6 TC26BK-21A442-A6 TC26AK-11A222-NA TC26AK-11A242-NA TC26AK-11A422-NA TC26AK-11A423-NA TC26AK-11B212-NA TC26AK-11B232-NA TC26AK-11D221-NA TC26AK-11D241-NA TC26AK-1HB222-NA TC26AK-1HB224-NA TC26AK-1HD224-NA TC26AK-1JD224-NA	TC26AK-11A442-NA TC26BK-11A222-IA TC26BK-11A242-IA TC26BK-11A442-IA TC26BK-11B212-IA TC26BK-11B232-IA TC26BK-21A222-IA TC26BK-1HB224-IA TC26BK-11D221-IA TC26BK-11A222-BR TC26BK-11A242-BR TC26BK-11A422-BR TC26BK-11A423-BR TC26BK-11A442-BR TC26BK-11B212-BR TC26BK-11B232-BR TC26BK-11D221-BR TC26BK-11D241-BR TC26BK-1HB224-BR TC26DK-11B212-TR TC26DK-11B232-TR TC26BK-11B212-TR TC26BK-11B232-TR TC26BK-11B212-ID TC26BK-11A222-ID TC26BK-11B212-XP TC26AK-1HD224-FT TC26AK-21A222-NA TC26AK-1JB224-NA	<a href="#">TC26 Home Page</a>
TC26 HC	TC26BK-1HD224-A6 TC26BK-1HB224-A6 TC26BK-1HB224-BR TC26AK-1HD222-NA TC26BK-1HB224-IA TC26AK-1JB224-NA TC26BK-1JB224-A6 TC26AK-1HD224-NA TC26AK-1HB224-NA KT-TC26AK-1HD224-FT TC26AK-1HB222-NA TC26AK-1JD224-NA	KT-TC26AK-1HD224-PTTP2-NA KT-TC26AK-1HD224-PTTP1-FT KT-TC26AK-1HD224-PTTP2-FT KT-TC26AK-1HD224-WFC1-NA KT-TC26AK-1HD224-WFC2-NA KT-TC26AK-1HD224-WFC1-FT	<a href="#">TC26 Home Page</a>

	KT-TC26BK-1HD224-PTTP1-A6 KT-TC26BK-1HD224-PTTP2-A6 KT-TC26BK-1HB224-PTTP1-A6 KT-TC26BK-1HB224-PTTP2-A6 KT-TC26AK-1HD224-PTTP1-NA	KT-TC26AK-1HD224-WFC2-FT KT-TC26BK-1HD224-WFC1-A6 KT-TC26BK-1HD224-WFC2-A6 KT-TC26BK-1HB224-WFC1-A6 KT-TC26BK-1HB224-WFC2-A6	
TC52	TC520K-1PEZU4P-A6 TC520K-1PEZU4P-NA	TC520K-1PEZU4P-IA TC520K-1PEZU4P-FT	<a href="#">TC52 Home Page</a>
TC52 AR1337 Camera	TC520K-1PFZU4P-A6	TC520K-1PFZU4P-NA	<a href="#">TC52 Home Page</a>
TC52 HC	TC520K-1HEZU4P-NA TC520K-1HEZU4P-EA TC520K-1HEZU4P-A6 TC520K-1HEZU4P-FT TC520K-1HEZU4P-IA KT-TC520K-1HCMH6P-PTT1-NA KT-TC520K-1HCMH6P-PTT2-NA KT-TC520K-1HCMH6P-PTT1-FT KT-TC520K-1HCMH6P-PTT2-FT KT-TC520K-1HCMH6P-PTT1-A6 KT-TC520K-1HCMH6P-PTT2-A6 KT-TC520K-1HEZU4P-PTT1-NA KT-TC520K-1HEZU4P-PTT2-NA	KT-TC520K-1HEZU4P-PTT1-FT KT-TC520K-1HEZU4P-PTT2-FT KT-TC520K-1HEZU4P-PTT1-A6 KT-TC520K-1HEZU4P-PTT2-A6 KT-TC520K-1HEZU4P-WFC1-NA KT-TC520K-1HEZU4P-WFC2-NA KT-TC520K-1HEZU4P-WFC1-FT KT-TC520K-1HEZU4P-WFC2-FT KT-TC520K-1HEZU4P-WFC1-A6 KT-TC520K-1HEZU4P-WFC2-A6 KT-TC52-1HEZWFC1-NA	<a href="#">TC52 HC Home Page</a>
TC57	TC57HO-1PEZU4P-A6 TC57HO-1PEZU4P-IA TC57HO-1PEZU4P-NA TC57HO-1PEZU4P-XP	TC57HO-1PEZU4P-BR TC57HO-1PEZU4P-ID TC57HO-1PEZU4P-FT TC57HO-1PEZU4P-SKT	<a href="#">TC57 Home Page</a>
TC57 AR1337 Camera	TC57HO-1PFZU4P-A6	TC57HO-1PFZU4P-NA	<a href="#">TC57 Home Page</a>
TC72	TC720L-0ME24B0-A6 TC720L-0ME24B0-NA TC720L-0ME24B0-BR TC720L-0ME24B0-IA TC720L-1ME24B0-A6	TC720L-0ME24B0-TN TC720L-0ME24B0-FT TC720L-0MJ24B0-A6 TC720L-0MJ24B0-NA	<a href="#">TC72 Home Page</a>

	TC720L-1ME24B0-NA		
TC72 AR1337 Camera	TC720L-0MK24B0-A6 TC720L-0MK24B0-NA	TC720L-0ML24B0-A6 TC720L-0ML24B0-NA	<a href="#">TC72 Home Page</a>
TC77	TC77HL-5ME24BG-A6 TC77HL-5ME24BD-IA TC77HL-5ME24BG-FT (FIPS_SKU) TC77HL-7MJ24BG-A6 TC77HL-5ME24BD-ID TC77HL-5ME24BG-EA TC77HL-5ME24BG-NA TC77HL-7ME24BG-NA TC77HL-7ML24BG-A6	TC77HL-5MG24BG-EA TC77HL-6ME34BG-A6 TC77HL-5ME24BD-BR TC77HL-5MJ24BG-A6 TC77HL-5MJ24BG-NA TC77HL-7MJ24BG-NA TC77HL-5MG24BG-A6 TC77HL-5ME24BD-TN TC77HL-7ME24BG-A6	<a href="#">TC77 Home Page</a>
TC77 AR1337 Camera	TC77HL-5MK24BG-A6 TC77HL-5MK24BG-NA	TC77HL-5ML24BG-A6 TC77HL-5ML24BG-NA	<a href="#">TC77 Home Page</a>
TC8300	TC83B0-x005A510NA TC83B0-x005A61CNA TC83BH-x205A710NA TC83B0-x005A510RW TC83B0-x005A61CRW TC83BH-x205A710RW TC83B0-x005A510IN TC83B0-x005A61CIN TC83BH-x205A710IN TC83BH-x206A710NA Note: 'x' Stands for wild card for different configurations	TC83BH-x206A710RW TC83B0-4005A610NA TC83B0-4005A610RW TC83B0-4005A610IN TC83B0-5005A610NA TC83B0-5005A610RW TC83B0-5005A610IN TC83B0-x005A510TA TC83BH-x205A710TA	<a href="#">TC8300 Home Page</a>
VC8300 8"	VC83-08FOCABAABA-I VC83-08FOCQBAABA-I VC83-08FOCQBAABANA VC83-08SOCABAABA-I	VC83-08SOCQBAABA-I VC83-08SOCQBAABANA VC83-08SOCQBAABAIN	<a href="#">VC8300 Home Page</a>
VC8300 10"	VC83-10SSCNBAABANA VC83-10SSCNBAABA-I	VC83-10SSCNBAABATR	
WT6300	WT63B0-TS0QNERW WT63B0-TS0QNENA WT63B0-TS0QNE01 WT63B0-TX0QNERW WT63B0-TX0QNENA	WT63B0-KS0QNERW WT63B0-KS0QNENA WT63B0-KX0QNERW WT63B0-KX0QNENA WT63B0-TS0QNETR	<a href="#">WT6300 Home Page</a>

## Component Versions

Component / Description	Version
Linux Kernel	4.19.157-perf
AnalyticsMgr	10.0.0.1002
Android SDK Level	30
Audio (Microphone and Speaker)	0.31.0.0
Battery Manager	1.3.2
Bluetooth Pairing Utility	3.27
Camera	2.0.002
DataWedge	11.4.122
EMDK	11.0.134.4034
License Manager and License agent	6.0.13 and 6.0.45.5.0.3
MXMF	11.8.0.9
NFC	NFC_NCIHALx_AR18C0.b.1.0
OEM info	9.0.0.828
OSX	QCT.110.11.19.35
RXlogger	7.0.3.8
ZWC	1.7.42
Scanning Framework	37.8.11.0
StageNow	11.8.0.9
WiFi6	FUSION_SA_2_1.11.0.0.017_R Radio: SA_2_1.11.0.0.016_R Application: SA_2_1.11.0.0.006_R Middleware: SA_2_1.11.0.0.0011_R SupPLICant: SA_2_1.11.0.0.005_R Firmware: 18.35.387.23.1308.9
WiFi5	FUSION_QA_2_1.11.0.0.014_R Radio: QA_2_1.11.0.0.009_R Application: QA_2_1.11.0.0.005_R

	Middleware: QA_2_1.11.0.0.008_R SupPLICant: QA_2_1.11.0.0.001_R Firmware: FW:3.3.5.1.1003.1 HW:HW_VERSION=40050000.
WorryFree WiFi	WA_A_2_7.4.0.026_R
Zebra Bluetooth	11.1.0
Zebra Volume Control	3.0.0.81
Zebra Data Service	10.0.4.1224
Touch FW	2.2.0-Finger-1-0:0*6e29bd Mode: Finger Only
Zebra Device Manager	11.8.0.9
Zebra Software License Manager	6.0.13
Embedded Controller Firmware	VC8300 8"/10": 3.3.01

## Revision History

Rev	Description	Date
1.0	Initial release	February 24, 2023