

Release Notes - Zebra MC3300R Android Oreo 02-13-15.00-OG-U14-STD Release (GMS)

[Introduction](#)

[Description](#)

[Component Contents](#)

[Installation Requirements](#)

[Installation Instructions](#)

[Device Compatibility](#)

[Known Issues and Limitations](#)

Introduction

Zebra MC3300R is the next generation key-based, rugged mid-range hand-held mobile computing device that supports RFID UHF tag reading and writing. MC3300R is available with a Mid-range or Long-range antenna and offers different physical key layouts. Running on a stable Android-O (8.1.0) OS, MC3300R offers the Zebra Value Add software solutions to enhance your Enterprise workflow.

The MC3300R is the professional-grade Android device built from the ground up for the Enterprise. It includes:

- Pre-installed RFID Applications and Manager
- Zebra's Mobility Extensions (Mx)
- Mobility DNA, a suite of mobility enabling applications, development tools and utilities
- Most advanced scan engine with longer range data capture capability.
- Rugged and ready for every day Enterprise use inside and outside the four walls

Description

This release contains the following software package which is compatible with the MC3300R GMS products.

LifeGuard patches are cumulative and include all previous fixes that are part of earlier patch releases.

Component Contents

Package Name	Package Description
CFE_ATLAS_02-13-15.00-OG-U14-STD.zip	OTA incremental CFE v14 update software for GMS build compatible for MC3300R products.

Component Version Info

Component / Description	Version
Product Build Number	02-13-15.00-OG-U14-STD
Android Version	8.1.0
Linux Kernel	3.10.84
Android SDK Level	27
Platform	QC8956
Bluetooth Stack	4.1
Flash Size	16/32GB
RAM Size	2/4GB
Scanning Framework	22.0.6.1
DataWedge	7.3.18
EMDK	7.3.14.2314
MXMF / OSX	MXMF : 9.0.2.4 / OSX : QCT.81.8.7
WiFi	FUSION_BA_2_11.0.0.024_O
NFC	Radio: BA_2_11.0.0.017_O
	Application: BA_2_11.0.0.012_O
	Middleware: BA_2_11.0.0.015_O
	Firmware: 7.35.205.8_20181002
	NFC_NCIHALx_AR003C.8.3.0_O_OpnSrc
PTT	3.1.39
Touch FW	26
RxLogger	5.4.12.0
Bluetooth Pairing Utility	3.14
Zebra Data Service	3.4.0.1180
Files	8.1.0
Stage Now	3.3.1.2000
Battery Swap	1.0
User Guide	1.0

Zebra Volume Control (ZVC)	2.1.0.14
Battery Manger	1.4.2
ActiveEdge	2.5.16
WorryFree WiFi Analyzer	3.2.20
Device Central	2.0.22.1
Zebra Software License Manager	3.1.1
Audio	0.8.0.0
Acoustic Profiles	General: DO3.1 Cellular: N/A
OemInfo	1.0.0.1059
OemConfig	9.0.1.0
Enterprise Keyboard (EKB)	2.1.1.0
Diagnostic Tool	1.17.0.9
Finger Print	Zebra/MC33/MC33:8.1.0/02-13-15.00-OG-U14-STD/72:user/release-keys Zebra/MC33/MC33C:8.1.0/02-13-15.00-OG-U14-STD/72:user/release-keys
Security Patch Level	May 01 2019
GMS Version	8.1_201809
RFID Module	PAAEES00-001-R03
RFID Radio	2.0.30.0
Zebra RFID Mobile (Demo App)	2.2.7.1
RFID Manager Application	2.0.10.1
RFID System Service	2.0.4.2

1. CFE v14 Updates:

❖ CFE_ATLAS_02-13-15.00-OG-U14-STD.zip (GMS)

1. Android Security Patch Level: May 01, 2019.

Use the link below to see the Android Security bulletin for more information:

<https://source.android.com/security/bulletin/>

2. Updated below mentioned components: For more detail please refer

<http://techdocs.zebra.com>

- DataWedge – Version 7.3.18
- StageNow – Version 3.3.1.2000
- EMDK – Version 7.3.14.2314
- MXMF – Version 9.0.2.4
- DDT – Version 1.17.0.9
- EKB – Version 2.1.1.0
- OemConfig – Version 9.0.1.0
- Scanning Framework – Version 22.0.6.1

- a. DotCode Symbology support is added for SE4750, SE4850, SE4710 and Camera Scanning.
 - b. Digimarc barcode decoding support is added for Camera Scanning.
 - c. Support for new Symbologies named FebraBan and Gridmatrix is added.
 - d. Instant Data Reporting (MultiBarcode) feature support is added.
- OSx – Version QCT.81.8.7
1. SPR36846/36693 – Fixed an issue wherein SIP shown area was patched up with white background when "Show Virtual Keyboard" setting is off and web page is opened.
 2. SPR36170 - Fixed an issue wherein ntp sync does not work when parameters are updated using Stagenow.
 3. SPR36143 - Resolved an issue wherein remapping of control modifier keys were not persisting across a reboot.
 4. SPR36697 – Resolved an issue wherein alpha keys do not work properly on 29-key keyboard.

2. FPU v13 Updates:

❖ FPU_ATLAS_02-13-15.00-OG-U13-STD.zip (GMS)

1. **Android Security Patch Level: April 01, 2019.**

Use the link below to see the Android Security bulletin for more information:

<https://source.android.com/security/bulletin/>

2. Added below new components
 - i. RFID Service
 - ii. RFID Manager application
 - iii. RFID Demo Application

Installation Requirements

- ADB installed on the PC (including adb drivers)
- USB debugging turned ON (from Developer options)
- MC3300R has at least:
 - Version 01-01-49.00-NG-U14-STD

Installation Instructions

FPU software update procedure for MC3300R:

The installation instructions assume you have ADB installed on your PC (the adb drivers etc..) and your MC3300R has developer options enabled and USB debugging ON. Instructions on HOW TO enable ADB is also captured in the user guide.

1. Connect the MC33 to the PC using the USB data cable or through the cradle.
2. You may need to pull down the top menu and if you see “USB for charging”, touch it and then change it to “File transfers”.
3. Open Command Prompt, run “*adb devices*” and check if you can see the device’s serial number... If yes, proceed... if not, you will need to get the PC set up with the proper drivers or install an External SD Card.
4. You may also get a pop up on your PC (Win 7) that you will be connected as a Portable Media Player... this can be ignored.

❖ Download Image

a) FPU_ATLAS_02-13-15.00-OG-U14-STD.zip listed above in content section

5. Entering Recovery Mode
 - a. Choice 1: In Command Prompt, type “*adb reboot recovery*” and click enter.
 - b. Choice 2:
 - Reboot the device while holding the Pistol Grip Trigger (**GUN Device**) or the Right Scan Trigger (**BRICK Device**)
 - When Zebra Technologies logo appears on the screen release the trigger
6. Your MC3300R will reboot and put you on the Android Recovery screen.
7. If applying update via sideload Method
 - a. Use the Volume + and – to highlight, “Apply update from ADB” and press the Power key to select it for applying OS upgrade package
8. if applying update via External SD card
 - a. Use the Volume + and – to highlight “Apply update from SD card” and press the Power Key to select it
 - b. Use the Volume + and – to highlight package FPU_ATLAS_02-13-15.00-OG-U14-STD.zip and press the Power Key to select it.
 - c. Go to Step 10 once above steps are completed
9. With your Command Prompt open in the Host machine, type “*adb sideload*” command and add a space and then drag and drop the FPU_ATLAS_02-13-15.00-OG-U14-STD.zip file on to it and click enter.
 - a. Your PC screen will show files being installed and a little blue horizontal progress bar

on your device will show status... and after about 6~ minutes (could be 10+ minutes if installing GMS) it should be done and you should be back at the Android Recovery screen.

10. *“Reboot system now”* is highlighted. Press the Power Key to Reboot.
11. At the Home Screen, we need to verify that the BSP upgrade took place and set the Date & Time.
 - a. Go to *“Settings”* and scroll down to *“About phone”* and look at the *“Build number”*. It should start with **“02-13-15.00-OG-U14-STD release keys”**. Now you are on the correct BSP.
12. Now you are all set to use your MC33x.

Device Compatibility

This software release has been approved for use on the following devices.

Device Part Number	Operating System	Device Part Number	Operating System
MC333R-GI2HG4US	Android N, O	MC333R-GI3HG4US	Android N, O
MC339R-GE2HG4US	Android N, O	MC339R-GE3HG4US	Android N, O
MC339R-GF2HG4US	Android N, O	MC339R-GF3HG4US	Android N, O
MC333R-GI2HG4EU	Android N, O	MC333R-GI3HG4EU	Android N, O
MC339R-GE2HG4EU	Android N, O	MC339R-GE3HG4EU	Android N, O
MC339R-GF2HG4EU	Android N, O	MC339R-GF3HG4EU	Android N, O
MC333R-GI2HG4IN	Android N, O	MC333R-GI4HG4US	Android N, O
MC339R-GF2HG4IN	Android N, O	MC339R-GE4HG4US	Android N, O
MC333R-GI2HG4JP	Android N, O	MC339R-GF4HG4US	Android N, O
MC333R-GI2HG4WR	Android N, O	MC333R-GI4HG4EU	Android N, O
MC339R-GE2HG4WR	Android N, O	MC339R-GE4HG4EU	Android N, O
MC339R-GF2HG4WR	Android N, O	MC339R-GF4HG4EU	Android N, O
MC333R-GI4HG4WR	Android N, O	MC339R-GF4HG4WR	Android N, O
MC333R-GI4HG4JP	Android N, O	MC339R-GF4HG4IN	Android N, O
MC333R-GI4HG4IN	Android N, O	MC339R-GE4HG4WR	Android N, O

Known Issues and Limitations

1. For an existing Data wedge profile which is configured for Image barcode scanning, if the user updates the profile for SimulScan data capture and reboots the device, the decoder list is shown as blank under DataWedge settings. As a workaround, user needs to use two different Data wedge profiles one for Imager barcode scanning and other profile for Simul scan data capture.
2. Ethernet shows Connected state when device is configured with Static IP and placed in multi-slot cradle without Ethernet cable.

3. On a SOTI DO, the touch goes unresponsive if SOTI message is received while user is entering multiple touch inputs to the screen. As a workaround, user can click on 'back' or 'home' button to dismiss the message box.

Last Revised: <05-23-2019>