
Release Notes - TC55 Android KK Update Image v2.68G GSM Worldwide (GMS)

[Introduction](#)

[Description](#)

[General Enhancements/Fixes](#)

[Contents](#)

[Device Compatibility](#)

[Installation Requirements](#)

[Installation Instructions](#)

[Notes](#)

[Part Number and Release Date](#)

Introduction

TC55 is a ruggedized device based on Android for the enterprise market that blends the capabilities of a smart phone with those of a traditional enterprise PDA.

TC55 has a number of enterprise-grade features, including a touch-screen that can be used with gloves, support for stylus input for signatures, barcode capture capability and IP67 rating for dust and water protection.

It also features Zebra Extensions (MX) to make the Android operating system more enterprise ready, with security enhancements and hooks for device management tools, and is designed for a longer lifecycle than the typical smart phone.

TC55 is designed in response to customer feedback from using consumer-grade smart phones in the workplace, especially with the bring-your-own-device (BYOD) trend, where employees use their own choice of device for work.

With TC55 the workers can capture practically any type of data — from bar codes and signatures to photos, videos and NFC — improving on the job efficiency and customer service. The screen is optimized for Enterprise viewing, helping ensure the battery lasts a full shift.

And with a drop, tumble and environmental sealing specification you can count on, it has the durability required to serve your field workers for years.

This SW release contains TC55 Android KitKat Rebranded SW version offering new advanced features, increasing operation performance for the customer satisfaction.

Description

1. Android KitKat 4.4.3
2. Kernel 3.4.0
3. DataWedge v 3.1.29
4. Scanning Framework v5.46.1
5. MX.v4.4.4
6. WLAN FUSION_QA_1.02.0.0.028
7. RIL 1.0.10
8. Modem 20015326.48
9. MSP v07.08.85
10. SOTI client v12.1.0 Build 23469
11. StageNow v 2.1.1.1425
12. SimulScan v1.11.1

General Enhancements/Fixes

1. Added support for Toshiba A15nm eMMC (Flash Memory)
2. Added backrev prevention logic to avoid KK 02.65 build and earlier OS releases on TC55 with A15nm eMMC memory
3. Data Analytics version is updated to 1.0.2.1856
4. Resolved an issue where the device reboots at random
5. Resolved an issue where the devices with no scanner will not auto suspend when idle
6. Integrated widevine drm plugin to fix the widevine media GTS failures

Contents

1. T55N0KXXVRUEN268G.zip – TC55 KK GMS OS Recovery Update package
2. ETSIT55N0KRUEN268G.zip - TC55 KK GMS ETSI OS Recovery Update package for JB customers migrating to KK. This will preserve the Enterprise Partition & ETSI WLAN Power table
3. FCCT55N0KRUEN268G.zip - TC55 KK GMS FCC OS Recovery Update package for JB customers migrating to KK. This will preserve the Enterprise Partition & FCC WLAN Power table
4. T55N0KXXVAUEN268G.apf – TC55 KK GMS OS Airbeam package for MSP deployment
5. ETSIT55N0KAUEN268G.apf - TC55 KK GMS ETSI OS Airbeam package for MSP deployment
6. FCCT55N0KAUEN268G.apf - TC55 KK GMS FCC OS Airbeam package for MSP deployment
7. T55N0KXXVREEN268G.zip - TC55 KK GMS Enterprise Reset Recovery package
8. T55N0KXXVRFEN268G.zip - TC55 KK GMS Factory Reset Recovery package
9. T55N0KXXVAEEN268G.apf - TC55 KK GMS Airbeam Enterprise Reset package
10. T55N0KXXVAFEN268G.apf - TC55 KK GMS Airbeam Factory Reset package

Notes

- a. Please note that only Enterprise partition and WLAN power table will be restored for JB to KK customers if ETSI or FCC package is used. All other settings of the device can be persisted only via MDM**
- b. Visual Voice Mail (VVM) is not supported for all carriers.**
- c. Enterprise Enabler is not needed for TC55 KK OS.**
- d. Once upgraded to KK, downgrade to JB is not supported.**
- e. Rollback packages cannot be flashed on TC55 terminals with A15nm eMMC hardware.**
- f. TC55 JB GMS terminals can be upgraded to KK GMS only. Reason:Customers who have GMS can only upgrade to GMS as devices are sold(SKU) based upon GMS/NON GMS.**

Device Compatibility

This software release has been approved for use with the following devices

SKUs supported:

TC55AH-HC11ES-ET
TC55AH-HC11EE-ET
TC55AH-HJ11ES-ET
TC55AH-HJ11EE-ET

TC55AH-H011ES-ET
TC55AH-H011EE-ET
TC55BH-H011EE-TW
TC55BH-H011ES-TW
TC55BH-HC11EE-TW
TC55BH-HC11ES-TW
TC55BH-HJ11EE-TW
TC55BH-HJ11ES-TW
TC55AH-HJ11ES
TC55AH-HJ11EE
TC55AH-HJ11ES-BL
TC55AH-HJ11EE-BL
TC55BH-HJ11ES
TC55BH-HJ11EE
TC55BH-HJ11ES-NS
TC55BH-HJ11EE-NS
TC55BH-HJ11JS-NS
TC55BH-HJ11JE-NS
TC55BH-HC11ES-NS
TC55BH-HC11EE-NS
TC55BH-H011ES-NS
TC55BH-H011EE-NS
TC55BH-H011EE
TC55BH-H011ES
TC55BH-HC11ES
TC55BH-HC11EE
TC55AH-HC11ES
TC55AH-HC11EE
TC55AH-HC11ES-BL
TC55AH-HC11EE-BL
TC55AH-H011ES
TC55AH-H011EE
TC55AH-H011ES-BL
TC55AH-H011EE-BL
TC55BH-HC11JS-NS
TC55BH-HC11JE-NS
TC55BH-HJ11KS-NS
TC55BH-HJ11KE-NS
TC55BH-H011KS-NS
TC55BH-H011KE-NS
TC55BH-HC11KS-NS
TC55BH-HC11KE-NS

And all TC55AH /TC55BH Jellybean SKUs.

Installation Requirements

This SW is intended for the TC55AH and TC55BH devices

Installation Instructions

For upgrading from older version of KK

1. T55N0KXXVRUEN268G.zip – TC55 KK GMS OS Recovery Update package

- Connect the USB cable from your PC to the device and enable USB mass storage mode on the device.
- On your PC you should see an internal and SD card (if SD card is present) appears in the File Explorer and copy the recovery update zip file to any storage.
- Press and hold on the device the Power button, Scan/Action button and Vol+ until the screen is turned OFF
- Release the Power and Scan/Action buttons and continue to hold Vol+ button
- The device should enter to Recovery update mode
- Release Vol+.
- Click on Vol+ or Vol- to navigate and select appropriated storage
- Click on on Scan/Action button to select the option
- Click on Vol+ or Vol- to navigate to the recovery update zip file
- Click on on Scan/Action button to select the recovery update zip file
- Reboot the device

2. T55N0KXXVRFEN268G.zip – TC55 KK GMS Factory Reset recovery package – Use only if you want to wipe Data and Enterprise partition

3. If after the update,Wi-Fi radio will not turn on,apply WLAN Region file Recovery update per Country Region – see the table below (not required for TC55 KitKat GMS devices out of factory)

To Upgrade from JB to KK:

ETSI customers should use: ETSIT55N0KRUEN268G.zip

FCC customers should use: FCCT55N0KRUEN268G.zip

Country Group (Region)	Country Codes	WLAN Region File
USA, Canada, Puerto Rico, American Virgin Island, Anguilla, Cayman Islands, Guam, Mariana Islands, Dutch Antilles, Curacao, Bonaire, Saint Eustatius and Saba, St Maarten,	US, CA, PR, VI, AI, KY, GU, MP, AN, CW, BQ, SX,	TC55KKFCCWLVN07.zip

Taiwan,	TW,	
Europe	AT, BE, BG, CY, CZ, DK, EE, FI, FR, DE, GR, HU, IS, IE, IT, LV, LI, LT, LU, MT, NL, NO, PL, PT, RO, SK, SI, ES, SE, CH, GB	TC55KK <u>ETSI</u> WLN07.zip
(w/ France)		
South Africa,	ZA,	
United Arab Emirates,	AE,	
Saudi Arabia,	SA,	
Turkey,	TR,	
Falkland Islands,	FK,	
French Guiana,	GF,	
Guadeloupe,	GP,	
Martinique,	MQ,	
Belarus,	BY,	
Macedonia	MK,	
Montenegro,	ME,	
Serbia,	RS,	
Croatia,	HR,	
Japan,	JP,	
Australia,	AU,	
New Zealand,	NZ,	
Christmas Island,	CX,	
Niue Island,	NU,	
Norfolk Island,	NF,	
Russia,	RU,	
Nicaragua,	NI,	
Paraguay,	PY,	
Peru,	PE,	
Philippines,	PH,	
Thailand,	TH,	
Trinidad&Tobago,	TT,	
Uruguay,	UY,	
Kazakhstan,	KZ,	
Argentina,	AR,	
Brazil,	BR,	
Colombia,	CO,	

Costa Rica,	CR,	
Dominican Republic,	DO,	
El Salvador,	SV,	
Ecuador,	EC,	
Hong Kong,	HK,	
Sri Lanka,	LK,	
Singapore,	SG,	
Chile,	CL,	
India,	IN,	
Mexico,	MX,	
Venezuela,	VE,	
Barbados,	BB,	
Panama,	PA,	
China	CN,	
Lebanon,	LB,	
Malaysia,	MY,	
Ukraine,	UA,	
Israel,	IL,	
Tunisia,	TN ,	
Egypt,	EG,	
Morocco,	MA,	
South Korea,	KR,	
Vietnam,	VN,	
Indonesia,	ID,	
Bolivia,	BO,	
British Virgin Islands,	VG,	
Guyana,	GY,	
Guatemala,	GT,	
Honduras,	HN,	
Jamaica,	JM,	
Algeria,	DZ,	
Nigeria,	NG,	
Kenya,	KE,	
Pakistan,	PK,	

4. MSP OS package update

Please refer Mobility Service Platform deployment guide for instruction for the deployment of the following files:

1. TC55 KK GMS OS Airbeam package

Part Number and Release Date

1. T55N0KXXVRUEN268G
2. ETSIT55N0KRUEN268G
3. FCCT55N0KRUEN268G
4. T55N0KXXVAUEN268G
5. ETSIT55N0KAUEN268G
6. FCCT55N0KAUEN268G
7. T55N0KXXVREEN268G
8. T55N0KXXVRFEN268G
9. T55N0KXXVAEEN268G
10. T55N0KXXVAFEN268G

November, 2016